

**FCA3000 and FCA3100 Series Timer/Counter/Analyzer**  
**MCA3000 Series Microwave Counter/Analyzer**  
**Quick Start User Manual**





**FCA3000 and FCA3100 Series Timer/Counter/Analyzer**  
**MCA3000 Series Microwave Counter/Analyzer**  
**Quick Start User Manual**

Copyright © Tektronix. All rights reserved. Licensed software products are owned by Tektronix or its subsidiaries or suppliers, and are protected by national copyright laws and international treaty provisions.

Tektronix products are covered by U.S. and foreign patents, issued and pending. Information in this publication supersedes that in all previously published material. Specifications and price change privileges reserved.

TEKTRONIX and TEK are registered trademarks of Tektronix, Inc.

LabVIEW, National Instruments, NI, and SignalExpress are trademarks of National Instruments.

TimeView is a trademark of Pendulum Instruments AB.

## **Contacting Tektronix**

Tektronix, Inc.  
14150 SW Karl Braun Drive  
P.O. Box 500  
Beaverton, OR 97077  
USA

For product information, sales, service, and technical support:

- In North America, call 1-800-833-9200.
- Worldwide, visit [www.tektronix.com](http://www.tektronix.com) to find contacts in your area.

## Warranty

Tektronix warrants that this product will be free from defects in materials and workmanship for a period of three (3) years from the date of shipment. If any such product proves defective during this warranty period, Tektronix, at its option, either will repair the defective product without charge for parts and labor, or will provide a replacement in exchange for the defective product. Parts, modules and replacement products used by Tektronix for warranty work may be new or reconditioned to like new performance. All replaced parts, modules and products become the property of Tektronix.

In order to obtain service under this warranty, Customer must notify Tektronix of the defect before the expiration of the warranty period and make suitable arrangements for the performance of service. Customer shall be responsible for packaging and shipping the defective product to the service center designated by Tektronix, with shipping charges prepaid. Tektronix shall pay for the return of the product to Customer if the shipment is to a location within the country in which the Tektronix service center is located. Customer shall be responsible for paying all shipping charges, duties, taxes, and any other charges for products returned to any other locations.

This warranty shall not apply to any defect, failure or damage caused by improper use or improper or inadequate maintenance and care. Tektronix shall not be obligated to furnish service under this warranty a) to repair damage resulting from attempts by personnel other than Tektronix representatives to install, repair or service the product; b) to repair damage resulting from improper use or connection to incompatible equipment; c) to repair any damage or malfunction caused by the use of non-Tektronix supplies; or d) to service a product that has been modified or integrated with other products when the effect of such modification or integration increases the time or difficulty of servicing the product.

THIS WARRANTY IS GIVEN BY TEKTRONIX WITH RESPECT TO THE PRODUCT IN LIEU OF ANY OTHER WARRANTIES, EXPRESS OR IMPLIED. TEKTRONIX AND ITS VENDORS DISCLAIM ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. TEKTRONIX' RESPONSIBILITY TO REPAIR OR REPLACE DEFECTIVE PRODUCTS IS THE SOLE AND EXCLUSIVE REMEDY PROVIDED TO THE CUSTOMER FOR BREACH OF THIS WARRANTY. TEKTRONIX AND ITS VENDORS WILL NOT BE LIABLE FOR ANY INDIRECT, SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES IRRESPECTIVE OF WHETHER TEKTRONIX OR THE VENDOR HAS ADVANCE NOTICE OF THE POSSIBILITY OF SUCH DAMAGES.

[W4 – 15AUG04]



# Table of Contents

Important safety information .....	iii
General safety summary.....	iii
Service safety summary .....	v
Terms in this manual .....	v
Symbols and terms on the product.....	v
Compliance Information .....	vi
EMC Compliance.....	vi
Safety Compliance .....	vii
Environmental Considerations.....	viii
Preface .....	ix
Key Features .....	ix
Documentation .....	x
Conventions Used in This Manual.....	x
Installation.....	1
Unpacking the Instrument .....	1
Operating Considerations.....	1
Powering the Instrument On and Off .....	2
Functional Check.....	2
Getting Acquainted with Your Instrument.....	3
Front Panel .....	3
Rear Panel .....	4
Input Connectors .....	5
Controls.....	6
Main Screen .....	9
Application Examples.....	12
Restore Default Settings.....	12
Basic Measurements.....	12
Math Measurement .....	13
Limit Testing .....	13
Two-Channel Measurements .....	15
Input C Measurements.....	15
Save an Instrument Setup .....	16
Connectivity .....	18





# Important safety information

This manual contains information and warnings that must be followed by the user for safe operation and to keep the product in a safe condition.

To safely perform service on this product, additional information is provided at the end of this section. (See page v, *Service safety summary*.)

## General safety summary

Use the product only as specified. Review the following safety precautions to avoid injury and prevent damage to this product or any products connected to it. Carefully read all instructions. Retain these instructions for future reference.

Comply with local and national safety codes.

For correct and safe operation of the product, it is essential that you follow generally accepted safety procedures in addition to the safety precautions specified in this manual.

The product is designed to be used by trained personnel only.

Only qualified personnel who are aware of the hazards involved should remove the cover for repair, maintenance, or adjustment.

Before use, always check the product with a known source to be sure it is operating correctly.

This product is not intended for detection of hazardous voltages.

Use personal protective equipment to prevent shock and arc blast injury where hazardous live conductors are exposed.

While using this product, you may need to access other parts of a larger system. Read the safety sections of the other component manuals for warnings and cautions related to operating the system.

When incorporating this equipment into a system, the safety of that system is the responsibility of the assembler of the system.

### To avoid fire or personal injury

**Use proper power cord.** Use only the power cord specified for this product and certified for the country of use.

Do not use the provided power cord for other products.

**Ground the product.** This product is grounded through the grounding conductor of the power cord. To avoid electric shock, the grounding conductor must be connected to earth ground. Before making connections to the input or output terminals of the product, make sure that the product is properly grounded.

Do not disable the power cord grounding connection.

**Power disconnect.** The power cord disconnects the product from the power source. See instructions for the location. Do not position the equipment so that it is difficult to access the power cord; it must remain accessible to the user at all times to allow for quick disconnection if needed.

**Connect and disconnect properly.** Do not connect or disconnect probes or test leads while they are connected to a voltage source.

**Observe all terminal ratings.** To avoid fire or shock hazard, observe all ratings and markings on the product. Consult the product manual for further ratings information before making connections to the product.

Do not apply a potential to any terminal, including the common terminal, that exceeds the maximum rating of that terminal.

The measuring terminals on this product are not rated for connection to mains or Category II, III, or IV circuits.

**Do not operate without covers.** Do not operate this product with covers or panels removed, or with the case open. Hazardous voltage exposure is possible.

**Avoid exposed circuitry.** Do not touch exposed connections and components when power is present.

**Do not operate with suspected failures.** If you suspect that there is damage to this product, have it inspected by qualified service personnel.

Disable the product if it is damaged. Do not use the product if it is damaged or operates incorrectly. If in doubt about safety of the product, turn it off and disconnect the power cord. Clearly mark the product to prevent its further operation.

Use only specified replacement parts.

**Use proper fuse.** Use only the fuse type and rating specified for this product.

**Do not operate in wet/damp conditions.** Be aware that condensation may occur if a unit is moved from a cold to a warm environment.

**Do not operate in an explosive atmosphere.**

**Keep product surfaces clean and dry.** Remove the input signals before you clean the product.

**Provide proper ventilation.** Refer to the installation instructions in the manual for details on installing the product so it has proper ventilation.

Slots and openings are provided for ventilation and should never be covered or otherwise obstructed. Do not push objects into any of the openings.

**Provide a safe working environment.** Always place the product in a location convenient for viewing the display and indicators.

Be sure your work area meets applicable ergonomic standards. Consult with an ergonomics professional to avoid stress injuries.

## Service safety summary

The *Service safety summary* section contains additional information required to safely perform service on the product. Only qualified personnel should perform service procedures. Read this *Service safety summary* and the *General safety summary* before performing any service procedures.

**To avoid electric shock.** Do not touch exposed connections.

**Do not service alone.** Do not perform internal service or adjustments of this product unless another person capable of rendering first aid and resuscitation is present.

**Disconnect power.** To avoid electric shock, switch off the product power and disconnect the power cord from the mains power before removing any covers or panels, or opening the case for servicing.

**Use care when servicing with power on.** Dangerous voltages or currents may exist in this product. Disconnect power, remove battery (if applicable), and disconnect test leads before removing protective panels, soldering, or replacing components.

**Verify safety after repair.** Always recheck ground continuity and mains dielectric strength after performing a repair.

## Terms in this manual

These terms may appear in this manual:



**WARNING.** Warning statements identify conditions or practices that could result in injury or loss of life.



**CAUTION.** Caution statements identify conditions or practices that could result in damage to this product or other property.

## Symbols and terms on the product

These terms may appear on the product:

- DANGER indicates an injury hazard immediately accessible as you read the marking.
- WARNING indicates an injury hazard not immediately accessible as you read the marking.
- CAUTION indicates a hazard to property including the product.



When this symbol is marked on the product, be sure to consult the manual to find out the nature of the potential hazards and any actions which have to be taken to avoid them. (This symbol may also be used to refer the user to ratings in the manual.)

The following symbol(s) may appear on the product:



CAUTION  
Refer to Manual



Protective Ground  
(Earth) Terminal



Chassis Ground



Standby

## Compliance Information

This section lists the EMC (electromagnetic compliance), safety, and environmental standards with which the instrument complies.

### EMC Compliance

#### EC Declaration of Conformity – EMC

Meets intent of Directive 2004/108/EC for Electromagnetic Compatibility. Compliance was demonstrated to the following specifications as listed in the Official Journal of the European Communities:

**EN 61326-1, EN 61326-2-1.** EMC requirements for electrical equipment for measurement, control, and laboratory use.<sup>1 2 3</sup>

- CISPR 11; IEC 61000-4-2; IEC 61000-4-3<sup>4</sup>; IEC 61000-4-4; IEC 61000-4-5; IEC 61000-4-6<sup>4</sup>; IEC 61000-4-11<sup>5</sup>

**EN 61000-3-2, EN 61000-3-3.**

#### European contact.

Tektronix UK, Ltd.  
Western Peninsula  
Western Road  
Bracknell, RG12 1RF

- <sup>1</sup> This product is intended for use in nonresidential areas only. Use in residential areas may cause electromagnetic interference.
- <sup>2</sup> Emissions which exceed the levels required by this standard may occur when this equipment is connected to a test object.
- <sup>3</sup> For compliance with the EMC standards listed here, high quality shielded interface cables should be used.
- <sup>4</sup> With a 10 MHz 0.1 Vp-p sine wave signal applied to the A or B input channels, the instrument's frequency readout value can typically vary up to  $\pm 1$  Hz beyond the inherent base variance, when the instrument is subjected to the fields and signals as defined in the IEC 61000-4-3 and IEC 61000-4-6 tests.
- <sup>5</sup> Performance Criterion C applied at the 70%/25 cycle Voltage-Dip and the 0%/250 cycle Voltage-Interruption test levels (IEC 61000-4-11).

#### Australia / New Zealand Declaration of Conformity – EMC

Complies with the EMC provision of the Radiocommunications Act per the following standard, in accordance with ACMA:

- CISPR 11

#### Australia / New Zealand contact.

Baker & McKenzie  
Level 27, AMP Centre  
50 Bridge Street  
Sydney NSW 2000, Australia

## Safety Compliance

This section lists the safety standards with which the product complies and other safety compliance information.

### EU Declaration of Conformity – Low Voltage

Compliance was demonstrated to the following specification as listed in the Official Journal of the European Communities:

- Low Voltage Directive 2006/95/EC.
- EN 61010-1

### U.S. Nationally Recognized Testing Laboratory Listing

- UL 61010-1

### Canadian Certification

- CAN/CSA-C22.2 No. 61010-1

### Additional Compliances

- IEC 61010-1

### Equipment type

Test and measuring equipment.

### Safety class

Class 1 – grounded product.

### Pollution degree rating

Pollution Degree 2 (as defined in IEC 61010-1). Rated for indoor, dry location use only.

### Mains overvoltage category rating

Overvoltage category II (as defined in IEC 61010-1).

## Environmental Considerations

This section provides information about the environmental impact of the product.

### Product End-of-Life Handling

Observe the following guidelines when recycling an instrument or component:

**Equipment recycling.** Production of this equipment required the extraction and use of natural resources. The equipment may contain substances that could be harmful to the environment or human health if improperly handled at the product's end of life. To avoid release of such substances into the environment and to reduce the use of natural resources, we encourage you to recycle this product in an appropriate system that will ensure that most of the materials are reused or recycled appropriately.



This symbol indicates that this product complies with the applicable European Union requirements according to Directives 2012/19/EU and 2006/66/EC on waste electrical and electronic equipment (WEEE) and batteries. For information about recycling options, check the Support/Service section of the Tektronix Web site ([www.tektronix.com](http://www.tektronix.com)).

### Restriction of Hazardous Substances

This product is classified as an industrial monitoring and control instrument, and is not required to comply with the substance restrictions of the recast RoHS Directive 2011/65/EU until July 22, 2017.

## Preface

This manual describes the installation and basic operations of the FCA3000 Series, FCA3100 Series, and MCA3000 Series instruments. For more detailed information see the *FCA3000 Series, FCA3100 Series, and MCA3000 Series User Manual* (provided as a PDF file on the product CD). This manual supports the following instruments:

- FCA3000 Series: FCA3000, FCA3003, and FCA3020
- FCA3100 Series: FCA3100, FCA3103, and FCA3120
- MCA3000 Series: MCA3027 and MCA3040

## Key Features

- Wide measurement frequency range to 40 GHz
- Fastest microwave counter on the market (25 ms acquisition time)
- Industry's only frequency counter with a graphical display
- High resolution down to 50 ps single shot (time), or 12 digits/s (frequency)
- Simultaneous display of signal frequency and voltage parameters
- Trigger sensitivity of 15 mVrms from DC to 200 MHz
- Voltage resolution to 1 mV
- Fast USB/GPIB bus transfer speeds, up to 15k measurements per second (block mode)
- Zero-dead time frequency/period measurements
- Best oven-controlled crystal oscillator (OCXO) time base options (1.5 E-8/year)
- MCA3000 Series offers microwave CW frequency measurements and very short burst measurements down to 40 ns
- Programmable Pulse output from 0.5 Hz to 50 MHz (FCA3100 Series)
- 10 MHz reference output oscillator
- Measurement Statistics Mode
- Histogram Mode
- Tend Plot mode
- Front or rear input connection options



 
 
## Documentation

Review the following for the location of different types of information available for this product.

To read about	Use these documents
Installation and Operation (overviews)	Quick Start User Manual. Provides general operating information.
In-Depth Operation and User Interface Help	User Manual (on the documentation browser disc). Provides detailed instructions for using instrument functions.
Programmer Commands	Programmer Manual (on the documentation browser disc). Includes GPIB command syntax.
Analysis and Connectivity Tools	National Instruments SignalView Express CD and the Connectivity Installation Instructions (on the documentation browser disc).

## Conventions Used in This Manual

The following icons are used throughout this manual.

Sequence Step	Front panel power	Connect power	USB
			

Sequential button pushes are separated with a > symbol. For example, **Meas > Pulse > Width Positive > A** means to push the **Meas** button, the **Pulse** menu button, the **Width Positive** menu button, and then the **A** menu button



# Installation

## Unpacking the Instrument

Unpack the instrument and check that you received all items listed as Standard Accessories. Check the Tektronix Web site ([www.tektronix.com](http://www.tektronix.com)) for the most current information, recommended accessories, instrument options, and upgrades.

### Standard Accessories

Accessory	Tektronix part number
FCA3000 and FCA3100 Series Timer/Counter/Analyzer, MCA3000 Series Microwave Counter/Analyzer Quick Start User Manual (English/Simplified Chinese/Japanese)	071-2787-xx
Product documentation CD-ROM	063-4288-xx
NI LabVIEW SignalExpress CD-ROM	063-4253-xx
Power cord	Country-specific
Type-N male to BNC adapter (FCA3003, FCA3020, FCA3103, and FCA3120 only)	N/A
Certificate of Calibration	N/A


## Operating Considerations

Please verify that the area in which you will use the instrument meets the following operating requirements:

Requirement	Description
Clearance	Top and bottom: 0 mm (0 in) Left and right side: 51 mm (2 in) Rear: 51 mm (2 in)
Line Power	100 – 240 VAC $\pm 10\%$ , CAT II: 50 – 400 Hz $\pm 10\%$ : 40 W
Temperature	Operating: 0 °C to +50 °C (32 °F to 122 °F) Nonoperating: –40 °C to +71 °C (–40 °F to +160 °F)
Humidity	+10 °C to +30 °C (50 °F to 86 °F): 5% to 95% +30 °C to +40 °C (86 °F to 104 °F): 5% to 75% +40 °C to +50 °C (104 °F to 122 °F): 5% to 45%
Altitude (maximum)	2000 m (6500 feet)
Maximum input voltage without damage, Input A and Input B	50 $\Omega$ : 12 V <sub>rms</sub> , 35 V <sub>peak</sub> for duty factor less than 0.1% 1 M $\Omega$ , 1X attenuator: 350 V (DC + AC pk) to 440 Hz, falling to 12 V <sub>rms</sub> at 1 MHz 1 M $\Omega$ , 10X attenuator: 350 V (DC + AC pk) to 440 Hz, falling to 12 V <sub>rms</sub> at 1 MHz
Maximum input level without damage, Input C	FCA3003, FCA3103: +34 dBm (12 V <sub>rms</sub> ) FCA3020, FCA3120: +27 dBm (5 V <sub>rms</sub> ) MCA3027, MCA3040: +18 dBm (1.78 V <sub>rms</sub> )

## Powering the Instrument On and Off

This instrument operates from a single-phase power source with the neutral conductor at or near earth ground. (See page 1, *Operating Considerations*.) A protective ground connection through the grounding conductor in the power cord is essential for safe operation.

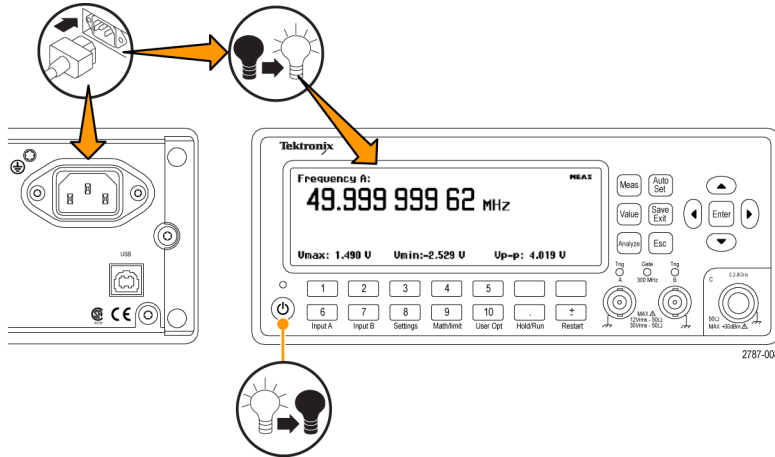


## Functional Check

1. Power on the instrument
2. Push **User Opt > Test**.
3. Push the **Test Mode** menu button and select **All**.
4. Push the **Start test** menu button. Verify that all tests pass.
5. Push the **OK** menu button to return to the previous measurements display.
6. Connect a 50  $\Omega$  cable from the **10 MHz Output** connector on the rear panel to the **Input A** connector on the front panel.
7. Push **Input A** and select **50  $\Omega$**  input impedance.
8. Push **Meas > Freq > Freq > A**. The instrument should read **10 MHz**.


# Getting Acquainted with Your Instrument

## Front Panel

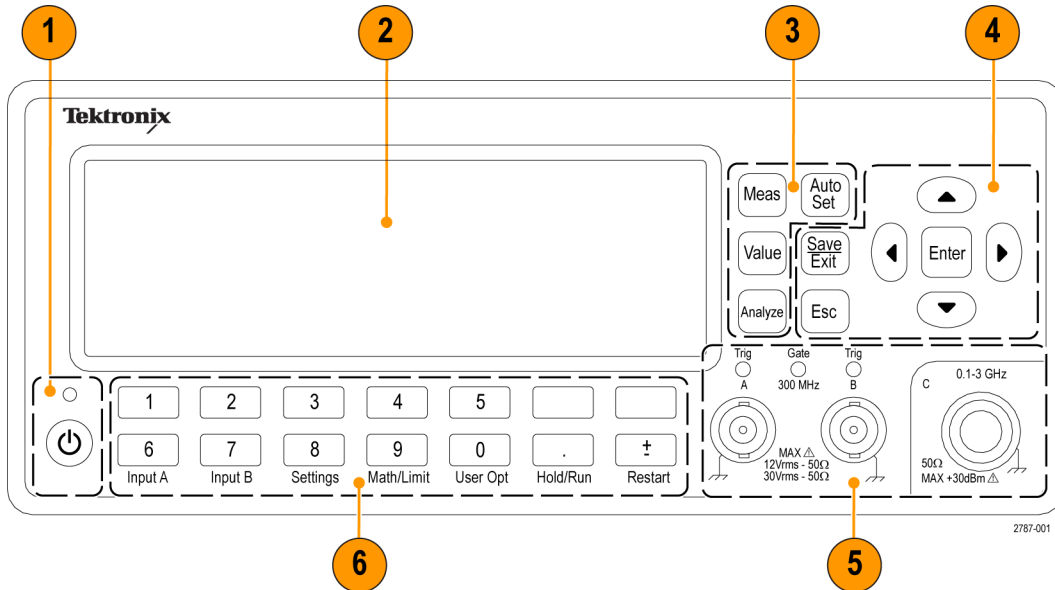


1. Power button (See page 6, *Power Button*.)
2. Main screen (See page 9, *Main Screen*.)
3. Measurement buttons (See page 6, *Measurement Buttons*.)
4. Navigation buttons (See page 7, *Navigation Buttons*.)
5. Input connectors (See page 5, *Input Connectors*.)
6. Keypad buttons (See page 7, *Keypad Buttons*.)

## Rear Panel

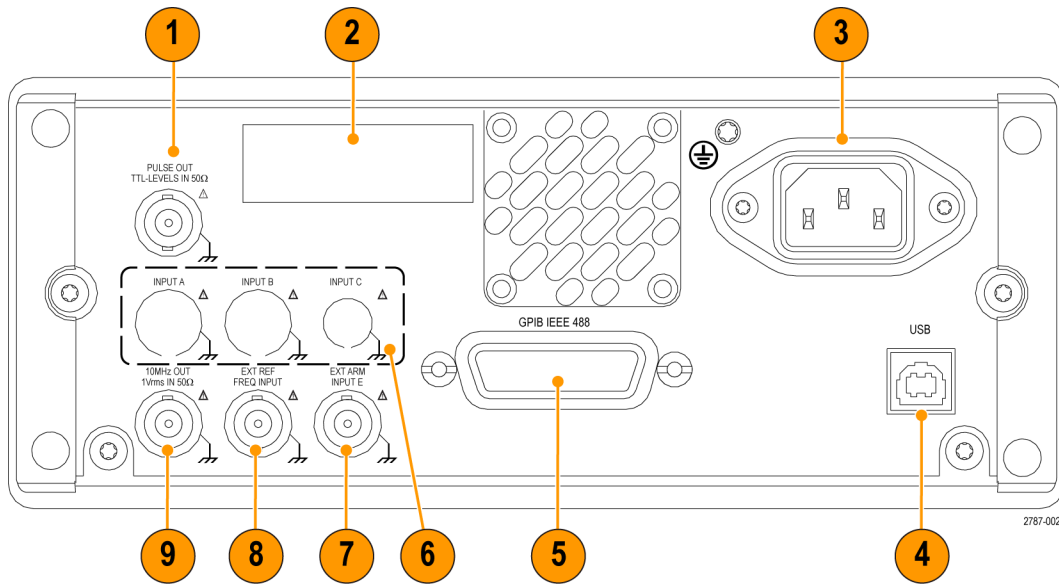

1. Pulse Output connector (FCA3100 Series only). (See page 5, *Preventing ESD*.)
2. ID label, including model, serial, installed options, and instrument electrical ratings.
3. Line power connector.
4. USB 2.0 12 Mb/s port to connect to PC.
5. GPIB port to connect to controller.
6. Optional input connectors (a factory-installed option that moves the front panel input connectors to the rear panel). Not available for MCA3000 Series instruments. (See page 5, *Preventing ESD*.)
7. External Arm Input connector (for external arming (synchronization) of measurements). The main inputs A and B can also be selected for measurement arming from the Settings Menu. (See page 5, *Preventing ESD*.)
8. External Reference Input connector (If the Measurement Reference is set to Auto in the Settings Menu, this input is automatically selected, provided a valid signal is present). (See page 5, *Preventing ESD*.)
9. 10 MHz Output connector. Provides a reference signal derived from the active measurement reference (internal or external reference). The measurement reference source is set in the Settings Menu. (See page 5, *Preventing ESD*.)

## Input Connectors

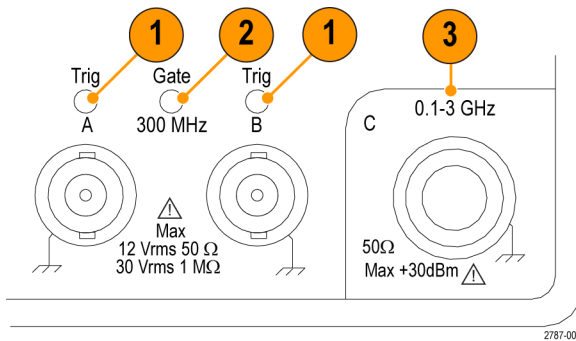

1. Input A and Input B connectors, and input trigger indicators.
2. Gate indicator. The GATE indicator is on when the counter is busy counting input cycles.
3. Input C prescaler (3 GHz or 20 GHz, FCA3000 Series and FCA3100 Series) or down converter (27 GHz or 40 GHz, MCA3000 Series) for measuring higher frequencies.

---

**NOTE.** Instruments with Option RP have the input connectors on the rear panel (FCA3000 Series and FCA3100 Series instruments only). The Gate and Trig A/B LED indicators remain on the front panel.

---

## Preventing ESD




---

**CAUTION.** A direct electrostatic discharge can damage the instrument input. To learn how to avoid this damage, read the following information.


---

Electrostatic discharge (ESD) is a concern when handling any electronic equipment. The instrument is designed with ESD protection, however it is possible that large discharges of static electricity directly into the signal input may damage the instrument. To avoid damage to the instrument, use the following techniques to remove electrostatic charge from yourself and test cables before connecting any cables to the instrument:

- Discharge the static voltage from your body by wearing a grounded antistatic wrist strap while connecting and disconnecting cables.
- A cable that is left unconnected on a bench can develop a large static charge. Discharge the static voltage from all cables before connecting them to the instrument or device under test by momentarily grounding the center conductor of the cable, or by connecting a 50  $\Omega$  termination to one end, before attaching the cable to the instrument.





## Controls

### Power Button

Item	Description
	<p>The <b>Power</b> button is a toggling secondary power switch. Part of the instrument is always on as soon as line power is applied, indicated by the red LED above the button. Push the Power button to power on or off the instrument.</p>




### Measurement Buttons

Use the Measurement buttons to select and display a measurement.

Item	Description
	<p>Use the <b>Meas</b> button to display the instrument measurement menu along the bottom of the screen. Push a menu button directly below a menu item to select that menu item and open a sub-menu as needed. Typical measurements include frequency, period, time, pulse, phase, totalize (FCA3100 Series only), and volts. The available menu items depend on the instrument model and configuration.</p>
	<p>Use the <b>Value</b> button to display the current measurement as a numerical value. The instrument also displays supplementary measurements along the lower part of the screen.</p>
	<p>Use the <b>Analyze</b> button to display the current measurement in one of three statistical analysis display modes. Repeatedly push the Analyze button to cycle through the statistical display modes:</p> <ul style="list-style-type: none"> <li>■ <b>Numerical display:</b> The instrument displays statistical data as numerical data. The statistical data readouts include Mean (running mean value of the main measurement over N samples), Max (maximum value), Min (minimum value), P-P (peak-to-peak deviation), Adev (Allan deviation), and Std (standard deviation). (See page 10, <i>Numerical display</i>.)</li> <li>■ <b>Histogram display:</b> The instrument displays successive main measurement results as a histogram. The bins in the histogram are autoscaled based on the measured data. Limits, if active, and the running mean value X are shown as vertical dotted lines. The center of the graph is indicated by a filled triangle on the X-axis. The plot scale factor, plot center measurement value, and measurement percent complete values are shown along the bottom of the plot. Limit settings affect the autoscaling to show the current measurements and the set limits simultaneously. (See page 11, <i>Histogram display</i>.) Use the <b>Settings &gt; Stat &gt; No. Of Samples</b> menu to set the number of bins along the horizontal axis.</li> <li>■ <b>Trend Plot display:</b> The instrument displays successive main measurement results as a trend plot. This mode is useful for observing periodic fluctuations or possible trends. The trend plot autoscales based on the measured data, starting with 0 at restart. Limits (if active) are shown as horizontal lines. (See page 11, <i>Trend plot display</i>.)</li> </ul>
	<p>Use the <b>Auto Set</b> button to automatically set trigger levels for the measurement function and input signal amplitude (for relatively normal signals). This enables you to quickly set the instrument to display a measurement.</p> <p>Push the Auto Set button twice within two seconds to reset most instrument settings (such as measuring time, mathematics, filter and arming) to their default values. The intention is to prevent possible lockups and misinterpretations when changing measurement function or test setup.</p>

## Navigation Buttons

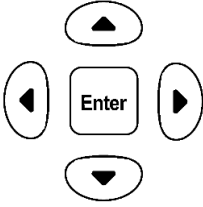
Use the Navigation buttons to select menu items, increment or decrement numeric setting values, and clear numeric values.

Item	Description
	<p>The Navigation buttons provide multiple functions depending on the instrument mode:</p> <p><b>Menu mode:</b> Use the left-arrow, right-arrow, and Enter buttons to display and select menu items (as an alternative to using the keypad menu select buttons).</p> <p><b>Numeric entry mode:</b> Use the left-arrow button to clear the right-most digit in a settings field. Use the up- and down-arrow buttons to increment or decrement a numeric value in a settings field (in a 1-2-5 pattern).</p> <p>Use the <b>Enter</b> button to accept the displayed value or menu and return to the previous menu.</p> <p>When the instrument is not displaying a menu or prompting for input, use the up- and down-arrow buttons to set the LCD screen contrast.</p>
	Use the <b>Save/Exit</b> button to confirm the current selection and exit to the previous menu level.
	Use the <b>Esc</b> button to exit to the previous menu level without confirming the current selection.

## Keypad Buttons
 
<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>		
Input A	Input B	Settings	Math/Limit	User Opt	Hold/Run	Restart

Use the keypad buttons to select menu items and enter setting values.

Item	Description
Numeric buttons	Use buttons 1-0, ., and ± to enter numeric parameter values.
Menu select buttons	Use the top row of the keypad buttons (1-5 and the two blank buttons) to select the corresponding screen menu items.
Menu access buttons	Use the bottom row of the keypad buttons (6-0) to display the menu for that button (Input A, Input B, Settings, and so on).
	<p>Use the <b>Input A</b> or <b>Input B</b> buttons to display the input channel configuration menu for the selected channel.</p> <p>The Input A and Input B menus provide channel-related settings, including trigger slope, signal coupling (AC or DC), input impedance (50 Ω or 1 MΩ), input attenuation (1x or 10x), trigger mode (Manual or Auto), Trigger level, and Filter (frequency cutoff).</p>

Item	Description
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; margin-bottom: 5px;">8</div> Settings	<p>Use the <b>Settings</b> button to display the measurement settings configuration menu.</p> <p>The Settings menu provides measurement-related settings, including Measure Time (for frequency measurements), Burst (for pulse-modulated signals), Arming (conditional measurement start/stop), Trigger Holdoff (stop trigger delay), Statistics (settings for statistical measurements including number of samples), Time base Reference (internal or external), and Miscellaneous (such as the input signal timeout period and the auto trigger low frequency setting).</p> <p>See the <i>FCA3000 Series and MCA3000 Series User Manual</i> for full information on these instrument menus and settings.</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; margin-bottom: 5px;">9</div> Math/Limit	<p>Use the <b>Math/Limit</b> button to display the math and limit testing configuration menus.</p> <p>The Math menu provides predefined formulas and user-defined constants to mathematically postprocess the measurement result. A typical use for math processing is to convert a measurement to take into account a mixer or multiplier that is part of the signal under test.</p> <p>The Limits menu lets you set numerical limits and select how the instrument reports limit violations.</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; margin-bottom: 5px;">0</div> User Opt	<p>Use the <b>User Opt</b> button to display the user options configuration menu.</p> <p>The User Options menu provides instrument settings, including saving or recalling instrument setups (factory default or up to twenty user setups in nonvolatile memory, each with a unique label), bus interface selection (USB or GPIB), GPIB bus configuration (mode, address), instrument self-tests, conditional pulse output signal setup (FCA3100 Series only), and instrument configuration information (model, serial number, firmware, and configuration).</p> <p>The User Options menu also provides an instrument calibration function. This internal calibration process requires password access. See the <i>FCA3000 and FCA3100 Series Timer/Counter/Analyzers and MCA3000 Series Microwave Counter/Analyzers Technical Reference Manual</i> for instructions on how to do an internal instrument calibration.</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; margin-bottom: 5px;">.</div> Hold/Run	<p>Use the <b>Hold/Run</b> button to control measurement acquisition. Push the button to toggle between run (constantly acquiring measurements) and hold (measurement pause) modes.</p> <p>The measurement indicator in the upper right corner of the screen changes from MEAS to HOLD when the instrument is in the measurement hold mode. Push the Hold/Run button again to resume the normal (continuous) measurement mode.</p> <p>While in the hold mode, you can push the Restart button to take single measurements. The measurement indicator in the upper right corner of the screen changes from HOLD to SING when the instrument is taking a single measurement.</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; margin-bottom: 5px;">±</div> Restart	<p>Use the <b>Restart</b> button to zero the measurement values and retake a measurement. This is useful when you need to initiate a new measurement after a change in the input signal, especially when using long measuring times.</p> <p>To take a single measurement, push Hold/Run to put the instrument in Hold mode (the measurement indicator changes from MEAS to HOLD), and then push the Restart button. The measurement indicator changes from HOLD to SING, the instrument takes the measurement, and the indicator returns to HOLD.</p> <p>Restart does not affect any instrument settings.</p>




## Main Screen

The instrument uses a monochrome LCD to show signal sources, instrument measurements (numerical and graphical), and menu items. What items are shown depends on the display mode.

### Measurement Value Mode


Push the Value button to enable this mode and show a high-resolution numeric readout of the current measurement.

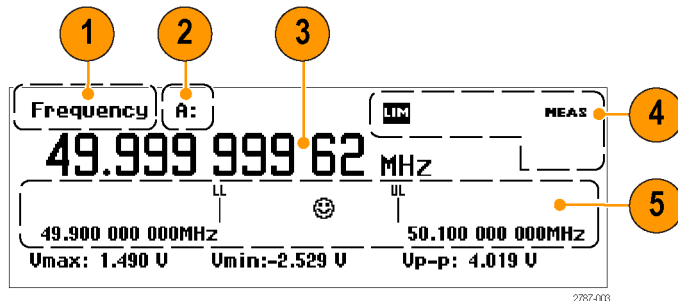

1. The current measurement.
2. The measurement signal source.
3. The main measurement readout. The readout at the bottom of the screen shows electrical information for the source signal. The readouts or display changes depending on the measurement or analysis mode.
4. Measurement status. Shows the math or limit testing mode (MATH or LIM), the measure status (MEAS, HOLD, or SING), and if the instrument is being remotely controlled from the GPIB bus (REM). The measurement status is present in all display modes.
5. Limit Alarm readout (when active). Lower limit (LL) and upper limit (UL) settings are shown as vertical bars with their associated limit value. An emoticon icon shows the relative measurement value and limit pass/fail state (a smiling face when the measurement is within the limits, and a frowning face when the measurement is outside the limits). The LIM status text at the top of the screen flashes when the measurement exceeds the limits, and continues to flash even when the measurement is back within limits. Push the **Restart** button to reset the LIM indicator.

### Menu Mode

Pushing a menu button (Meas, Input A, Input B, Settings, Math/Limit, or User Opt) replaces the lower screen area with the menu items for that button. The following figure shows the menu items for the Meas button.

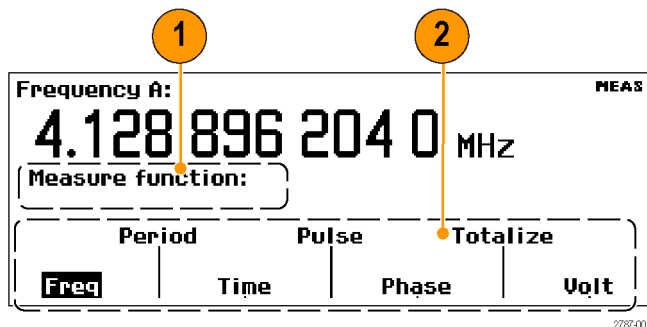


1. The Path area shows the menu path of the current menu selections.
2. The Menu area shows the available menu options. Push the keypad button directly below a menu item to select that item and/or open a lower-level menu. The current selection is shown in inverse text. You can also use the Navigation buttons to highlight and select menu items.

## Analyze Modes


The Analyze modes (accessible by repeatedly pushing the Analyze button) apply basic statistical analysis to measurements to display numerical, histogram, or trend plot statistical analysis readouts.

**Numerical display.** The instrument takes successive measurements and displays the results as numeric statistical readouts.

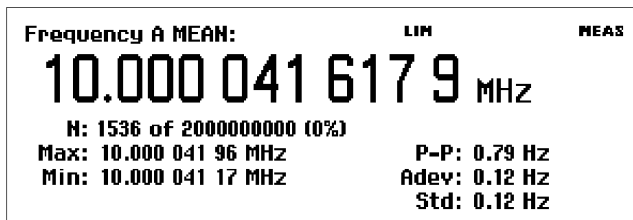


- MEAN: The main measurement shows the running mean value over N samples.
- N: The number of measurement samples (set in the Settings > Stat menu).
- Max, Min: The maximum and minimum measurement values.
- P-P: The peak-to-peak deviation.
- Adev: Allan deviation.
- Std: Standard deviation.

**Histogram display.** The instrument displays successive measurements as a histogram. The number of bins along the horizontal axis are set in the **Settings > Stat** menu.

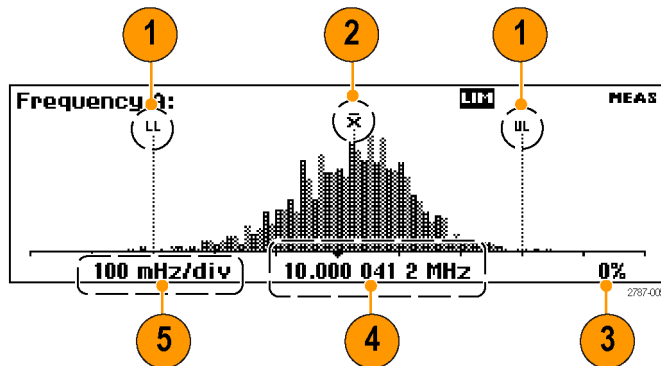

1. The upper and lower Limits Alarm levels (if active). When limit testing is active, the instrument autoscales the graph to show both the histogram and the limit. The instrument only uses data inside the limits for autoscaling; measurements outside the visible graph area are shown by an arrowhead at the left or the right edge of the display.
2. The running mean measurement value ( $\bar{X}$ ).
3. The percent of the measurement completed.
4. The graph center (marked with a dark triangle) and corresponding frequency.
5. The graph horizontal scale per division. Limits Alarm (if active) sets the scale to show both the current measurements and the limit settings. The instrument continually autoscales the histogram bins based on the measured data.

**Trend plot display.** The instrument takes successive measurements and plots the values over time. This mode is useful for observing fluctuations or measurement deviation trends. A trend plot stops (if Hold is activated) or restarts (if Run is activated) after the set number of samples is completed. The trend plot graph continually autoscales based on the measured data, starting with zero at restart. Limit Alarms, if active, are shown as horizontal lines.

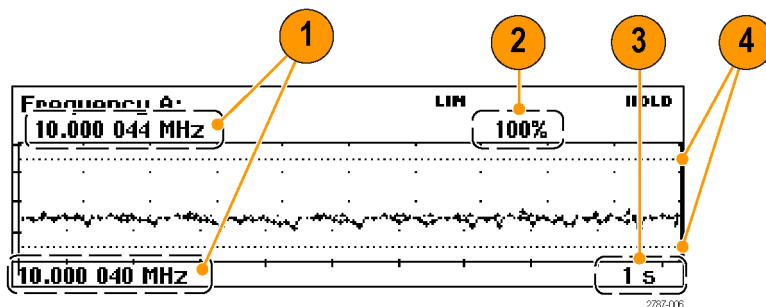


1. The upper and lower frequency range of the plot display. The trend plot graph continually autoscales based on the measured data to show the measurement trend values.
2. The percent of the measurement completed.
3. The horizontal units per division.
4. The Limits Alarm levels (if active). When limit testing is active, the instrument sets the graph scale to show both the measurement trend plot and the limit values (horizontal dashed lines).

# Application Examples

Assumptions for the examples in this section unless noted otherwise; 1 MHz signal, 5 Vpp square wave source connected to the instrument using 50 Ω cables; input signals levels and frequency are within acceptable range.

## Restore Default Settings


1. Push **User Opt > Save/Recall > Setup > Recall Setup > Default** to recall (load) the instrument default setup. The instrument displays the Frequency measurement by default.

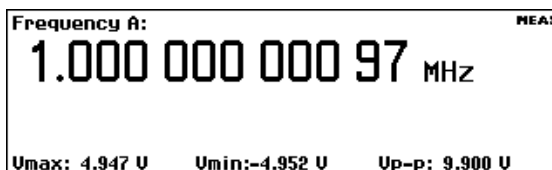


## Basic Measurements

Prerequisite: Reset the instrument to the default settings. (See page 12, *Restore Default Settings*.)

1. Push **Meas** to open the Measurement menu.
2. Select a measurement by using the menu softkeys below a menu item.

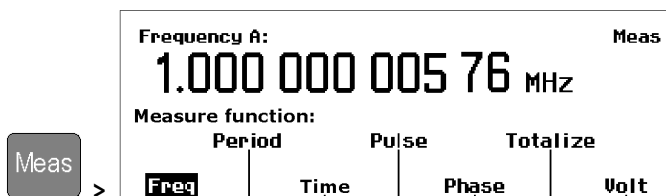

For example, select **Period > Single > A** to display the period measurement for Input A.

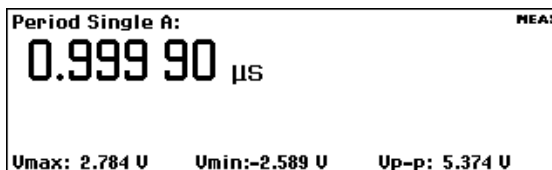


## Math Measurement


The built-in math functions let you apply postprocessing operations, such as scaling and offsetting to the measurement. One use for this is to display the deviation from a desired value. This is known as offsetting. The value X in the formulas represents the instrument measurement value.

Prerequisite: Reset the instrument to the default settings. (See page 12, *Restore Default Settings*.)


1. Push **Math/Limit** to open the Math and Limits menu.

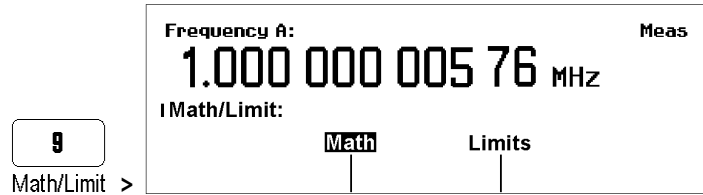


2. Select **Math > Math Off > (K\*X+L)/M**.

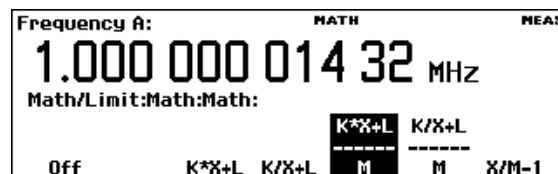

3. Select **L** and enter **-1 EE6**.

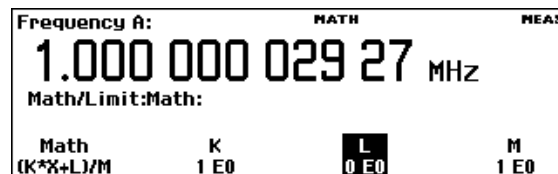


4. Repeatedly push **Save/Exit** to exit the menu levels and return to the measurement readout. The instrument displays the deviation frequency from 1 MHz (in this case, 29.91 milliHertz).

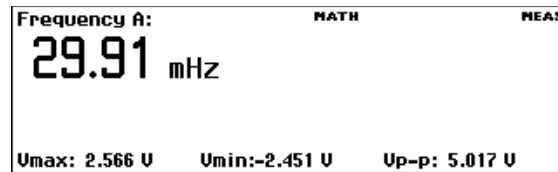

## Limit Testing

This example tests frequency limits, but you can set test limits for most measurements.


1. Reset the instrument to the default settings. (See page 12, *Restore Default Settings*.)
2. Push **Math/Limit** and select **Limits**.

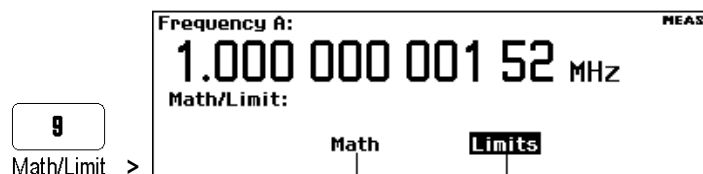


3. Push **Limit Behavior Off** and select **Alarm\_Stop**. The instrument returns to the previous menu and changes the Limit Behavior menu label to Alarm\_Stop.



4. Verify that the Limit Mode is set to **Range**.

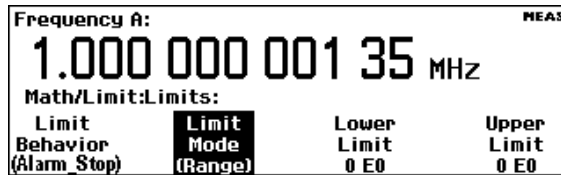


5. Select **Lower Limit** and enter the lower measurement limit value. Push **Enter** or **Save/Exit** to accept the value.  
 Repeat this step to set the **Upper Limit** value.

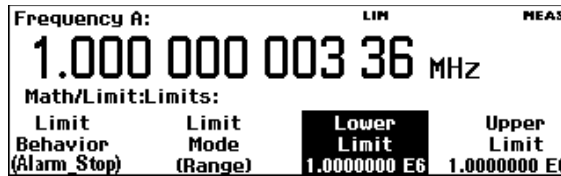

Math/Limit:Limits:  
 Lower Limit: 1.000000001 EE6

6. Repeatedly push **Save/Exit** to exit the menu system and return to the measurement display. Then push **Restart**.

The range mode limit test readout uses vertical lines to represent the lower and upper limit values, and an emoticon (smiley face) to indicate when the measurement is within or outside the limits.

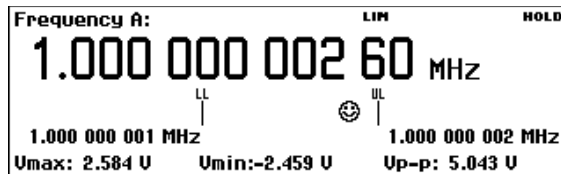


Measurements that are outside the displayed limits are shown with a frowning emoticon and a flashing LIM status indicator.



Measurements that are outside the limit test scale are shown with an arrow at the left or the right edge of the screen. The instrument only uses data that is inside the limits for autoscaling.



- You can also display the limit settings as part of other readouts. For example, push the **Analyze** button repeatedly until the instrument shows the Histogram readout.

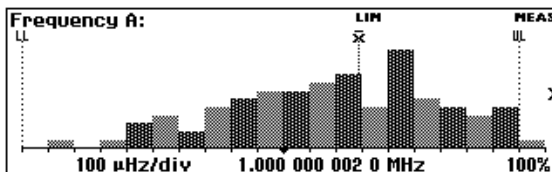

- To stop (disable) limit testing, push **Math/Limit > Limit Behavior > Off**.


## Two-Channel Measurements

Prerequisite: Reset the instrument to the default settings. (See page 12, *Restore Default Settings*.)


- Push the **Input A** and **Input B** buttons and verify that the settings are appropriate for your measurement. The input settings are identical for this example.

<b>Input A:</b>						
1		1MΩ	10x	Man	Trig	Filter
J	DC	50Ω	1x	Auto	50 %	(Off)
<b>Input B:</b>						
1		1MΩ	10x	Man	Trig	Filter
J	DC	50Ω	1x	Auto	50 %	(Off)

- Connect signals to inputs A and B.
- Push **Meas** and select **Phase > B Rel A**. The instrument displays the B input phase difference relative to the A input.

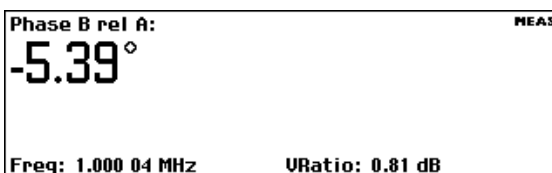

- Push **Meas** and select **Time > Time Interval > A to B**. The instrument displays the time interval from the rising edge of Input A to the rising edge of Input B.

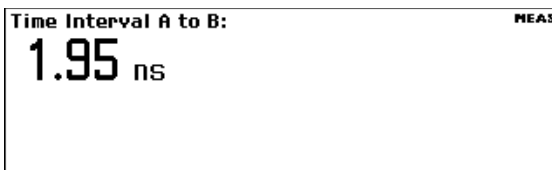

## Input C Measurements

Instruments that include the Input C high-frequency prescaler (FCA3000 Series, FCA3100 Series) or down converter (MCA3000 Series) provide a subset of measurements for the C input. These measurements are Frequency, Frequency Ratio (C to A and C to B), Frequency Burst, and Period (Average). Input C is added to the relevant menus on the instrument.

Use normal processes to set the instrument to take measurements on Input C. See the *FCA3000 Series, FCA3100 Series, and MCA3000 Series User Manual* for more information on Input C measurements.

## Save an Instrument Setup


The instrument provides 20 nonvolatile memory locations in which to store instrument setup information. All instrument parameters are stored including measurement settings, trigger levels, mathematical constants, and so on. You can label each stored setup with a unique identifier (up to seven characters long).

---


**NOTE.** Restoring the default instrument setup does not erase the setups stored in memory.

---

1. Set the instrument to the configuration that you want to save.
2. Push **User Opt > Save/Recall > Setup > Save Current Setup.**

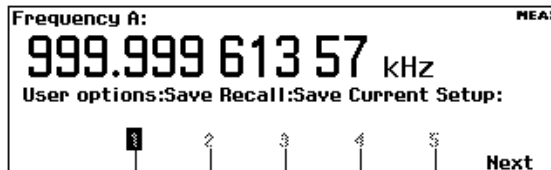

 3. Select **Next** until the instrument displays an available location (indicated by a black font number). Locations that are empty or unavailable are shown in gray text.
4. Push the menu key to select a location number.





---

**NOTE.** Setup locations 1 through 10 are protected by default to prevent accidental overwriting of their contents. See the User manual for information on setup location protection.

---



5. Use the menu softkeys to enter a label (up to seven characters long) for the instrument setup file. The default label is derived from the current measurement.
6. Use the Navigation buttons to backspace over characters or move the insertion cursor to a new position.
7. Push **Enter** or **Save/Exit** to accept the label text and save the instrument setup.

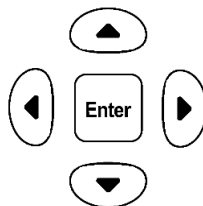



## Recall a Setup

1. Push **User Opt** > **Save/Recall** > **Setup** > **Recall Setup**.
2. Push the **Next** menu button to display the location from which to recall the instrument setup. Locations that are empty are shown in gray text.
3. Push the menu button for the setup location. The instrument loads the setup and displays the measurement associated with that setup.

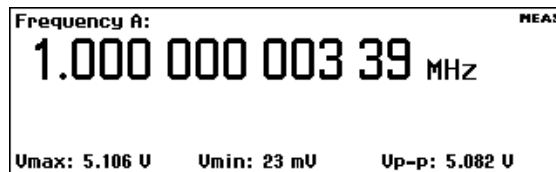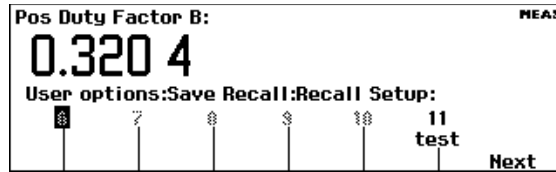

## Connectivity

With the fast USB and GPIB bus transfer speeds of your FCA3000, FCA3100, and MCA3000 Series bench instrument, you can easily capture, save, and analyze measurement results by using the special Tektronix edition of National Instruments LabVIEW SignalExpress™ software. Every instrument ships with a free copy of the Tektronix version of SignalExpress for basic instrument control, data logging and analysis. An optional Full Edition offers over 200 built-in functions that provide additional signal processing, advanced analysis, sweeping, limit testing and user-defined step capabilities.

SignalExpress connects the entire range of Tektronix bench instruments to let you access the feature-rich tools of each instrument from one intuitive software interface. A single interface lets you automate complex measurements requiring multiple instruments, time correlate data from multiple instruments, log data for an extended period of time, and easily capture and analyze your results, all from your PC.

An optional TimeView™ Modulation Domain Analysis PC software application (TVA3000) allows for instrument remote control and the analysis and display of measurement results in a choice of graphs. You can analyze practically any type of dynamic variation of time or frequency, including modulation, jitter, wander, sweep linearity, frequency agile communication, wireless LANs, Bluetooth frequency hopping, VCO frequency response and much more. For example, you can display results as raw data, as a statistical histogram, as a waveform graph (as if you were using an oscilloscope), or as an FFT spectrum graph. TimeView also lets you analyze modulation parameters such as modulation depth or frequency modulation index. You can download a 30-day trial version of TimeView from the Tektronix Web site ([www.tektronix.com](http://www.tektronix.com)).

FCA3000 および FCA3100 シリーズ・タイマ／カウンタ／アナライザ  
MCA3000 シリーズ・マイクロ波カウンタ／アナライザ  
クイック・スタート・ユーザ・マニュアル



071-2788-02

**Tektronix**



FCA3000 および FCA3100 シリーズ・タイマ／カウンタ  
／アナライザ  
MCA3000 シリーズ・マイクロ波カウンタ／アナライザ  
クイック・スタート・ユーザ・マニュアル

Copyright © Tektronix. All rights reserved. 使用許諾ソフトウェア製品は、Tektronix またはその子会社や供給者が所有するもので、米国著作権法および国際条約の規定によって保護されています。

Tektronix 製品は、登録済および出願中の米国その他の国の特許等により保護されています。本書の内容は、既に発行されている他の資料の内容に代わるものです。また、本製品の仕様および価格は、予告なく変更させていただく場合がございますので、予めご了承ください。

TEKTRONIX および TEK は Tektronix, Inc. の登録商標です。

LabVIEW、National Instruments、NI、および SignalExpress は National Instruments の商標です。

TimeView は Pendulum Instruments AB の商標です。

## **Tektronix 連絡先**

Tektronix, Inc.  
14150 SW Karl Braun Drive  
P.O. Box 500  
Beaverton, OR 97077  
USA

製品情報、代理店、サービス、およびテクニカル・サポート:

- 北米内: 1-800-833-9200 までお電話ください。
- 世界の他の地域では、[www.tektronix.com](http://www.tektronix.com) にアクセスし、お近くの代理店をお探してください。

## 保証

当社では、本製品において、出荷の日から3年間、材料およびその仕上がりについて欠陥がないことを保証します。この保証期間中に製品に欠陥があることが判明した場合、当社では、当社の裁量に基づき、部品および作業の費用を請求せずに当該欠陥製品を修理するか、あるいは当該欠陥製品の交換品を提供します。保証時に当社が使用する部品、モジュール、および交換する製品は、新しいパフォーマンスに適応するために、新品の場合、または再生品の場合もあります。交換したすべての部品、モジュール、および製品は当社で保有されます。

本保証に基づきサービスをお受けいただくため、お客様には、本保証期間の満了前に当該欠陥を当社に通知していただき、サービス実施のための適切な措置を講じていただきます。お客様には、当該欠陥製品を梱包していただき、送料前払いにて当社指定のサービス・センターに送付していただきます。本製品がお客様に返送される場合において、返送先が当該サービス・センターの設置されている国内の場所であるときは、当社は、返送費用を負担します。しかし、他の場所に返送される製品については、すべての送料、関税、税金その他の費用をお客様に負担していただきます。

本保証は、不適切な使用または不適切もしくは不十分な保守および取り扱いにより生じたいかなる欠陥、故障または損傷にも適用されません。当社は、以下の事項については、本保証に基づきサービスを提供する義務を負いません。a) 当社担当者以外の者による本製品のインストール、修理またはサービスの試行から生じた損傷に対する修理。b) 不適切な使用または互換性のない機器への接続から生じた損傷に対する修理。c) 当社製ではないサプライ用品の使用により生じた損傷または機能不全に対する修理。d) 本製品が改造または他の製品と統合された場合において、改造または統合の影響により当該本製品のサービスの時間または難度が増加したときの当該本製品に対するサービス。

この保証は、明示的または黙示的な他のあらゆる保証の代わりに、製品に関して当社がお客様に対して提供するものです。当社およびベンダは、商品性または特定目的に対する適合性についての一切の黙示保証を否認します。欠陥製品を修理または交換する当社の責任は、本保証の不履行についてお客様に提供される唯一の排他的な法的救済となります。間接損害、特別損害、付随的損害または派生損害については、当社およびそのベンダは、損害の実現性を事前に通知されていたか否に拘わらず、一切の責任を負いません。

[W4 - 15AUG04]





## 目次

安全性に関する重要な情報.....	iii
安全にご使用いただくために.....	iii
安全に保守点検していただくために.....	v
本マニュアル内の用語.....	vi
本製品に使用される記号と用語.....	vi
適合性に関する情報.....	vii
EMC 適合性.....	vii
安全性.....	viii
環境への配慮.....	ix
まえがき.....	x
主な特長.....	x
マニュアル.....	xi
このマニュアルで使用する表記規則.....	xi
設置.....	1
機器の開梱.....	1
動作条件.....	1
機器の電源投入と切断.....	2
機能チェック.....	2
機器の概要.....	3
前面パネル.....	3
後部パネル.....	4
入力コネクタ.....	5
コントロール.....	6
メイン画面.....	9
使用例.....	12
デフォルト設定のリストア.....	12
基本的な測定.....	12
演算測定.....	13
リミット・テスト.....	13
2チャンネルの測定.....	15
Input C の測定.....	15
機器の設定値の保存.....	16
拡張性.....	18



# 安全性に関する重要な情報

このマニュアルには、操作を行うユーザの安全を確保し、製品を安全な状態に保つために順守しなければならない情報および警告が記載されています。

このセクションの最後には、製品を安全に保守するために必要な追加情報が記載されています。(v ページ「安全に保守点検していただくために」参照)。

## 安全にご使用いただくために

製品は指定された方法でのみご使用ください。人体への損傷を避け、本製品や本製品に接続されている製品の破損を防止するために、安全性に関する次の注意事項をよくお読みください。すべての指示事項を注意深くお読みください。必要なときに参照できるように、説明書を安全な場所に保管しておいてください。

該当する地域および国の安全基準に従ってご使用ください。

本製品を正しく安全にご使用になるには、このマニュアルに記載された注意事項に従うだけでなく、一般に認められている安全対策を徹底しておく必要があります。

本製品は訓練を受けた専門知識のあるユーザによる使用を想定しています。

製品のカバーを取り外して修理や保守、または調整を実施できるのは、あらゆる危険性を認識した専門的知識のある適格者のみに限定する必要があります。

使用前に、既知の情報源と十分に照らし合わせて、製品が正しく動作していることを常にチェックしてください。

本製品は危険電圧の検出用にはご利用になれません。

危険な通電導体が露出している部分では、感電やアーク・フラッシュによってけがをするおそれがありますので、保護具を使用してください。

本製品をご使用の際に、より大きな他のシステムにアクセスしなければならない場合があります。他のシステムの操作に関する警告や注意事項については、その製品コンポーネントのマニュアルにある安全に関するセクションをお読みください。

本機器をシステムの一部としてご使用になる場合には、そのシステムの構築者が安全性に関する責任を果たさなければなりません。

## 火災や人体への損傷を避けるには

**適切な電源コードを使用してください:** 本製品用に指定され、使用される国で認定された電源コードのみを使用してください。

他の製品の電源コードは使用しないでください。

**本製品を接地してください:** 本製品は、電源コードのグラウンド線を使用して接地します。感電を避けるため、グラウンド線をアースに接続する必要があります。本製品の入出力端子に接続する前に、本製品が正しく接地されていることを確認してください。

電源コードのグラウンド接続を無効にしないでください。

**電源の切断:** 電源コードの取り外しによって主電源が遮断されます。スイッチの位置については、使用説明書を参照してください。電源コードの取り扱いが困難な場所には設置しないでください。必要に応じてすぐに電源を遮断できるように、ユーザが常にアクセスできる状態にしておく必要があります。

**接続と切断は正しく行ってください:** プローブとテスト・リードが電圧源に接続されている間は接続または切断しないでください。

**すべての端子の定格に従ってください:** 火災や感電の危険を避けるために、本製品のすべての定格とマーキングに従ってください。本製品に電源を接続する前に、定格の詳細について、製品マニュアルを参照してください。

コモン端子を含むいかなる端子にも、その端子の最大定格を超える電圧をかけないでください。

本製品の測定端子は、AC 電源、カテゴリ II、III、および IV 回路には使用できません。

**カバーを外した状態で動作させないでください:** カバーやパネルを外した状態やケースを開いたまま動作させないでください。危険性の高い電圧に接触してしまう可能性があります。

**露出した回路への接触は避けてください:** 電源が投入されているときに、露出した接続部分やコンポーネントに触れないでください。

**故障の疑いがあるときは使用しないでください:** 本製品に故障の疑いがある場合には、資格のあるサービス担当者に検査を依頼してください。

製品が故障している場合には、使用を停止してください。製品が故障している場合や正常に動作していない場合には、製品を使用しないでください。安全上の問題が疑われる場合には、電源を切って電源コードを取り外してください。誤って使用されることがないように、問題のある製品を区別できるようにしておいてください。

指定された交換部品のみを使用するようにしてください。

**適切なヒューズを使用してください:** 本製品用に指定されたヒューズ・タイプおよび定格のみを使用してください。

**湿気の多いところでは動作させないでください:** 機器を寒い場所から暖かい場所に移動する際には、結露にご注意ください。

**爆発性のガスがある場所では使用しないでください:**

**製品の表面を清潔で乾燥した状態に保ってください:** 製品の清掃を開始する前に、入力信号を取り外してください。

**適切に通気してください:** 適切な通気が得られるように製品を設置できるように、マニュアルの設置手順を参照してください。

製品には通気用のスロットや開口部があります。その部分を覆ったり、通気が妨げられたりすることがないようにしてください。開口部には異物を入れないでください。

**安全な作業環境を確保してください:** 製品は常にディスプレイやインジケータがよく見える場所に設置してください。

作業場が該当する人間工学規格を満たしていることを確認してください。ストレスに由来するけががないように、人間工学の専門家に助言を求めてください。

## 安全に保守点検していただくために

「安全に保守点検していただくために」のセクションには、製品の保守点検を安全に行うために必要な詳細な情報が記載されています。資格のあるサービス担当者以外は、保守点検手順を実行しないでください。保守点検を行う前には、この「安全に保守点検していただくために」と「安全にご使用いただくために」を読んでください。

**感電を避けてください:** 露出した接続部には触れないでください。

**保守点検は単独で行わないでください:** 応急処置と救急蘇生ができる人の介在がないかぎり、本製品の内部点検や調整を行わないでください。

**電源を切断してください:** 保守点検の際にカバーやパネルを外したり、ケースを開く前に、感電を避けるため、製品の電源を切り、電源コードを電源コンセントから抜いてください。

**電源オン時の保守点検には十分注意してください:** 本製品には、危険な電圧や電流が存在している可能性があります。保護パネルの取り外し、はんだ付け、コンポーネントの交換をする前に、電源の切断、バッテリーの取り外し(可能な場合)、テスト・リードの切断を行ってください。

**修理後の安全確認:** 修理を行った後には、常にグラウンド導通と電源の絶縁耐力を再チェックしてください。

## 本マニュアル内の用語

このマニュアルでは次の用語を使用します。



**警告:** 人体や生命に危害をおよぼすおそれのある状態や行為を示します。

---



**注意:** 本製品やその他の接続機器に損害を与えるおそれのある状態や行為を示します。

---

## 本製品に使用される記号と用語

本製品では、次の用語を使用します。

- 危険: ただちに人体や生命に危険をおよぼす可能性があることを示します。
- 警告: 人体や生命に危険をおよぼす可能性があることを示します。
- 注意: 本製品を含む周辺機器に損傷を与える可能性があることを示します。



製品にこの記号が表記されているときは、マニュアルを参照して、想定される危険性とそれらを回避するために必要な行動について確認してください。(マニュアルでは、この記号はユーザーに定格を示すために使用される場合があります)。

本製品では、次の記号を使用します。



CAUTION  
Refer to Manual



Protective Ground  
(Earth) Terminal



Chassis Ground



Standby

# 適合性に関する情報

このセクションでは、本製品が適合している EMC 基準、安全基準、および環境基準について説明します。

## EMC 適合性

### EC 適合宣言 - EMC

指令 2004/108/EC 電磁環境両立性に適合します。『Official Journal of the European Communities』に記載の以下の基準に準拠します。

**EN 61326-1、EN 61326-2-1:** 測定、制御、および実験用途の電子機器を対象とする EMC 基準<sup>1 2 3</sup>

- CISPR 11、IEC 61000-4-2、IEC 61000-4-3<sup>4</sup>、IEC 61000-4-4、IEC 61000-4-5、IEC 61000-4-6<sup>4</sup>、IEC 61000-4-11<sup>5</sup>

**EN 61000-3-2、EN 61000-3-3:**

#### 欧州域内連絡先:

Tektronix UK, Ltd.  
Western Peninsula  
Western Road  
Bracknell, RG12 1RF

- 1 本製品は住居区域以外での使用を目的としたものです。住居区域で使用すると、電磁干渉の原因となることがあります。
- 2 本製品をテスト対象に接続した状態では、この規格が要求するレベルを超えるエミッションが発生する可能性があります。
- 3 ここに挙げた各種 EMC 規格に確実に準拠するには、高品質なシールドを持つインタフェース・ケーブルが必要です。
- 4 機器に IEC 61000-4-3 および IEC 61000-4-6 の各試験で定義する電磁界と信号をかけ、10 MHz、0.1 V<sub>p-p</sub> の正弦波信号を A または B 入力チャンネルに印加した場合、機器の周波数リードアウト値は固有基本変動を超えて標準で最大 ±1 Hz まで変化することがあります。
- 5 70%/25 サイクルの電圧低下および 0%/250 サイクル瞬断の各テスト・レベルにおいて、性能基準 C を適用します (IEC 61000-4-11)。

### オーストラリア／ニュージーランド適合宣言 - EMC

ACMA に従い、次の規格に準拠することで Radiocommunications Act の EMC 条項に適合しています。

- CISPR 11

#### オーストラリア／ニュージーランドの連絡先:

Baker & McKenzie  
Level 27, AMP Centre  
50 Bridge Street  
Sydney NSW 2000, Australia

## 安全性

このセクションでは、製品が適合している安全規格およびその他の基準について説明します。

### EU 適合宣言 - 低電圧指令

『Official Journal of the European Communities』に記載の以下の基準に準拠します。

- 低電圧指令 2006/95/EC
- EN 61010-1

### 米国の国家認定試験機関のリスト

- UL 61010-1

### カナダ規格

- CAN/CSA-C22.2 No. 61010-1

### その他の基準に対する適合性

- IEC 61010-1

### 機器の種類

テスト機器および計測機器

### 安全クラス

クラス 1 - アース付き製品

### 汚染度

汚染度 2 (IEC 61010-1 の定義による)。乾燥した屋内でのみ使用できます。

### 主電源過電圧カテゴリ定格

過電圧カテゴリ II (IEC 61010-1 の定義による)。



## 環境への配慮

このセクションでは本製品が環境におよぼす影響について説明します。

### 使用済み製品の処理方法

機器またはコンポーネントをリサイクルする際には、次のガイドラインを順守してください。

**機器のリサイクル:** 本製品の製造には天然資源が使用されています。本製品には環境または人体に有害となる可能性のある物質が含まれているため、製品を廃棄する際には適切に処理する必要があります。有害物質の放出を防ぎ、天然資源の使用を減らすため、本製品の部材の再利用とリサイクルの徹底にご協力ください。



このマークは、本製品が WEEE (廃棄電気・電子機器) およびバッテリーに関する指令 2012/19/EC および 2006/66/EC に基づき、EU の諸要件に準拠していることを示しています。リサイクル方法については、当社の Web サイト ([www.tektronix.com](http://www.tektronix.com)) のサービス・セクションを参照してください。

### 有害物質に関する規制

本機は産業用監視および制御装置に分類されており、2017 年 7 月 22 日までは、改訂 RoHS Directive 2011/65/EU の含有物質制限に準拠する義務はありません。

## まえがき

本マニュアルでは、FCA3000 シリーズ、FCA3100 シリーズ、および MCA3000 シリーズの機器のインストールおよび基本的な操作について説明します。詳細については、FCA3000 シリーズ、FCA3100 シリーズ、および MCA3000 シリーズ・ユーザ・マニュアル(製品 CD 内の PDF ファイルとして提供されます)を参照してください。このマニュアルは次の機器を対象にしています。

- FCA3000 シリーズ:FCA3000 型、FCA3003 型、FCA3020 型
- FCA3100 シリーズ:FCA3100 型、FCA3103 型、FCA3120 型
- MCA3000 シリーズ:MCA3027 型、MCA3040 型

## 主な特長

- 40 GHz の幅広い測定周波数レンジ
- 業界最高速のマイクロ波カウンタ(25 ms のアキュイジション・タイム)
- 業界唯一のグラフィカル・ディスプレイ付き周波数カウンタ
- 50 ps シングル・ショット(時間)、または 12 桁/s(周波数)の高分解能
- 信号の周波数と電圧パラメータの同時表示
- DC ~ 200 MHz で 15 mVrms のトリガ感度
- 1 mV の電圧分解能
- 高速 USB/GPIB バス転送速度、最大で毎秒 15k の測定(ブロック・モード)
- ゼロ・デッド・タイムの周波数/周期測定
- 最上位の OCXO(恒温槽型水晶発振器)タイム・ベース・オプション(1.5 E-8/年)
- MAC3000 シリーズはマイクロ波 CW 周波数測定、および 40 ns までの極短バースト測定が可能
- 0.5 Hz ~ 50 MHz のプログラマブル・パルス出力(FCA3100 シリーズ)
- 10 MHz リファレンス出力オシレータ
- 測定値統計モード
- ヒストグラム・モード
- トレンド・プロット・モード
- フロントまたはリアの入力接続オプション



 
 
## マニュアル

本製品に関する各種マニュアルの参照先は次のとおりです。

参照項目	参照するマニュアル
インストレーション、操作概要	クイック・スタート・ユーザ・マニュアル: 操作情報の概要を提供します。
操作方法の詳細とユーザ・インタフェースに関するヘルプ	ユーザ・マニュアル (ドキュメンテーション・ブラウザ・ディスクに搭載): 機器の機能を使用するための詳細な指示を提供します。
プログラマ・コマンド	プログラマ・マニュアル (ドキュメンテーション・ブラウザ・ディスクに搭載): GPIB のコマンド構文が含まれています。
解析、接続ツール	National Instruments の SignalView Express CD および Connectivity Installation Instructions (ドキュメンテーション・ブラウザ・ディスクに搭載)

## このマニュアルで使用する表記規則

このマニュアルでは、次のアイコンが使用されています。

実行順序	フロントパネルの電源	電源の接続	USB
			

連続したボタン操作は > 記号で区切られています。例えば、**Meas > Pulse > Width Positive > A** は、**Meas** ボタン、**Pulse** メニュー・ボタン、**Width Positive** メニュー・ボタン、そして **A** メニュー・ボタンを押すことを意味します。



# 設置

## 機器の開梱

本機を開梱し、スタンダード・アクセサリとして記載されているすべての付属品が含まれていることを確認します。最新の情報、推奨アクセサリ、機器のオプション、およびアップグレードについては、当社 Web サイト ([www.tektronix.com](http://www.tektronix.com)) を参照してください。

### スタンダード・アクセサリ

アクセサリ	当社部品番号
FCA3000 および FCA3100 シリーズ・タイマ/カウンタ/アナライザ、MCA3000 シリーズ・マイクロ波カウンタ/アナライザ・クイック・スタート・ユーザ・マニュアル (英語版/簡体中国語版/日本語版)	071-2787-xx
製品マニュアル CD-ROM	063-4288-xx
NI LabVIEW SignalExpress CD-ROM	063-4253-xx
電源ケーブル	各国固有
N オス-BNC アダプタ (FCA3003 型、FCA3020 型、FCA3103 型および FCA3120 型のみ)	-
校正証明書	-


## 動作条件

機器を使用する場所が、以下の動作要件を満たしていることを確認してください。

要件	概要
周囲のスペース	上部および底部: 0 mm 左側および右側: 51 mm 後部: 51 mm
AC 電源	100 ~ 240 VAC ±10%、CAT II: 50 ~ 400 Hz ±10%: 40 W
温度	動作時: 0 °C ~ +50 °C (32 °F ~ 122 °F) 非動作時: -40 °C ~ +71 °C (-40 °F ~ +160 °F)
湿度	+10 °C ~ +30 °C (50 °F ~ 86 °F): 5% ~ 95% +30 °C ~ +40 °C (86 °F ~ 104 °F): 5% ~ 75% +40 °C ~ +50 °C (104 °F ~ 122 °F): 5% ~ 45%
高度 (最大)	2,000 m (198,120.00 cm)
非破壊最大入力電圧、入力 A および入力 B	50 Ω: 12 V <sub>rms</sub> 、デューティ・ファクタ 0.1% 未満で 35 V <sub>peak</sub> 、 1 MΩ、1X アッテネータ: 440 Hz までは 350 V (DC + AC pk)、1 MHz では 12 V <sub>rms</sub> まで低下 1 MΩ、10X アッテネータ: 440 Hz までは 350 V (DC + AC pk)、1 MHz では 12 V <sub>rms</sub> まで低下
非破壊最大入力レベル、入力 C	FCA3003 型、FCA3103 型: +34 dBm (12 V <sub>rms</sub> ) FCA3020 型、FCA3120 型: +27 dBm (5 V <sub>rms</sub> ) MCA3027 型、MCA3040 型: +18 dBm (1.78 V <sub>rms</sub> )

## 機器の電源投入と切断

本製品は接地電位近傍の中性線を有する単相電源で動作します。(1 ページ「動作条件」参照)。安全な操作のために、電源コードの接地線を通じた保護用グランド接続が不可欠です。

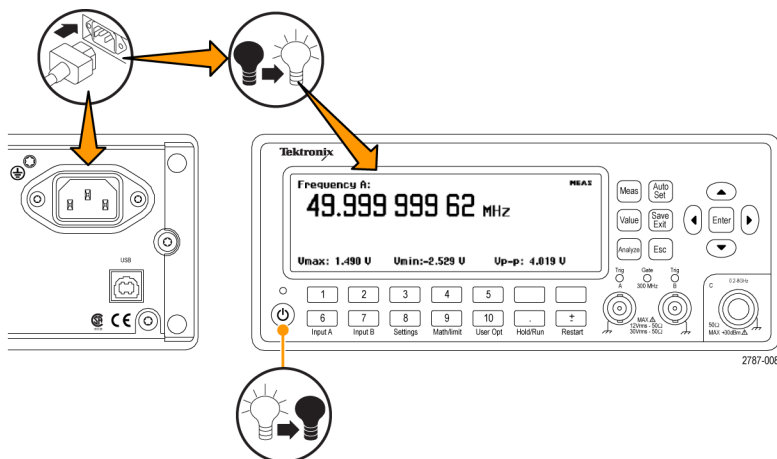


## 機能チェック

1. 機器の電源の投入
2. User Opt > Test の順に押します。
3. Test Mode メニュー・ボタンを押して、All を選択します。
4. Start test メニュー・ボタンを押します。すべてのテストに合格することを確認します。
5. OK メニュー・ボタンを押して、前の測定画面に戻ります。
6. リア・パネルの 10 MHz Output コネクタから、フロント・パネルの Input A コネクタに 50 Ω のケーブルを接続します。
7. Input A を押して、50 Ω の入力インピーダンスを選択します。
8. Meas > Freq > Freq > A の順に押します。機器が 10 MHz を示します。


# 機器の概要

## 前面パネル

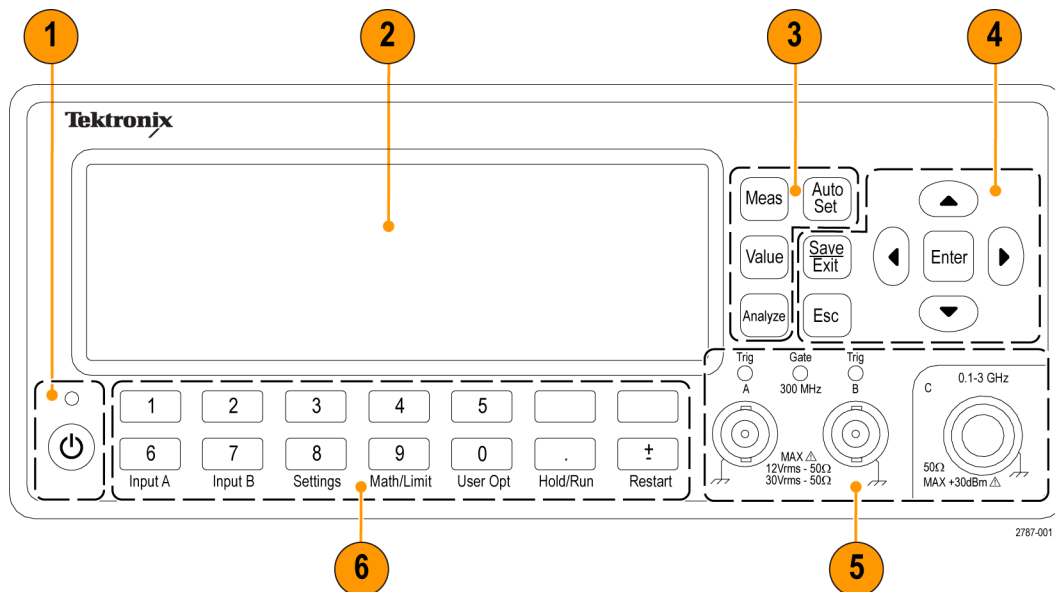

1. 電源ボタン(6 ページ「電源ボタン」参照)。
2. メイン画面(9 ページ「メイン画面」参照)。
3. 測定ボタン(6 ページ「測定ボタン」参照)。
4. ナビゲーション・ボタン(7 ページ「ナビゲーション・ボタン」参照)。
5. 入力コネクタ(5 ページ「入力コネクタ」参照)。
6. キーパッド・ボタン(7 ページ「キーパッド・ボタン」参照)。


## 後部パネル

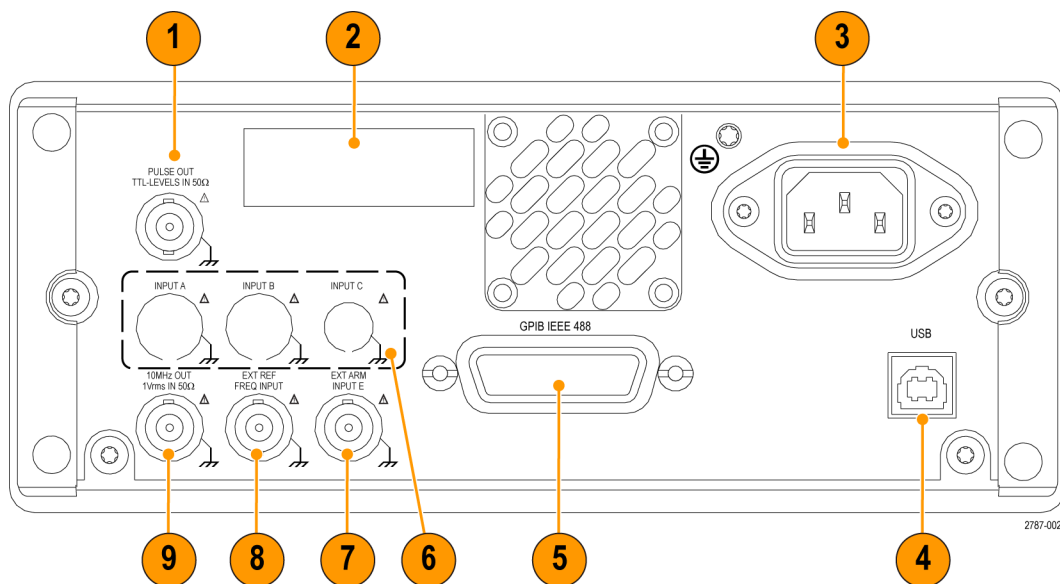

1. パルス出力コネクタ (FCA3100 シリーズのみ) (5 ページ「ESD の防止」参照)。
2. 型番、シリアル番号、インストール・オプション、および機器の電気定格を記載した ID ラベル
3. AC 電源コネクタ
4. PC 接続用の USB 2.0 12 Mbps ポート
5. コントローラ接続用の GPIB ポート
6. オプションの入力コネクタ (フロント・パネルの入力コネクタ類をリア・パネルに移動する工場出荷時オプション)。MCA3000 シリーズの機器では使用できません。(5 ページ「ESD の防止」参照)。
7. 外部アーミング入力コネクタ (測定の外部アーミング (同期) 用)。Settings メニューで、メイン入力 A および B も測定アーミングに選択できます。(5 ページ「ESD の防止」参照)。
8. 外部リファレンス入力コネクタ (Settings メニューで Measurement Reference が Auto に設定され、有効な信号が入力されている場合、この入力自動的に選択されます)。(5 ページ「ESD の防止」参照)。
9. 10 MHz 出力コネクタ。アクティブな測定リファレンス (内部または外部リファレンス) からのリファレンス信号を出力します。測定リファレンス・ソースは Settings メニューで設定されます (5 ページ「ESD の防止」参照)。



## 入力コネクタ

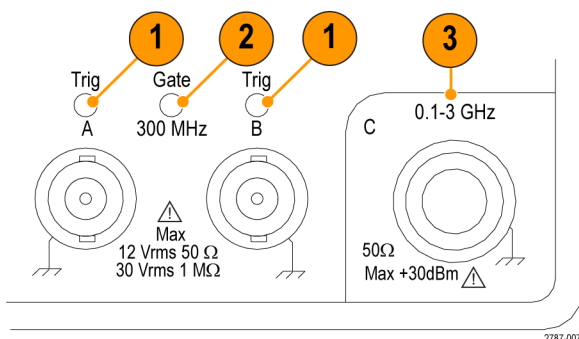

1. 入力 A および入力 B コネクタ、および入力トリガ・インジケータ。
2. ゲート・インジケータ。カウンタによる入力サイクルのカウント中は Gate インジケータが点灯します。
3. 入力 C プリスケラ (3 GHz または 20 GHz、FCA3000 シリーズおよび FCA3100 シリーズ) または、高周波測定用ダウン・コンバータ (27 GHz または 40 GHz、MCA3000 シリーズ)

**注:** 機器にオプション RP 型が付属する場合、入力コネクタはリア・パネルとなります (FCA3000 シリーズおよび FCA3100 シリーズの機器のみ)。Gate および Trig A/B の LED インジケータは、フロント・パネルに残ります。

## ESD の防止



**注意:** 直接的な静電気放電により機器の入力が損傷することがあります。このような損傷を回避する方法について、以下の情報をお読みください。

どのような電子機器を取り扱う場合でも、ESD (静電気放電) に常に注意を払う必要があります。本器には ESD 対策が施されていますが、信号入力への直接の大きな静電気放電が生じると機器を損傷する可能性があります。機器への損傷を回避するために、機器にケーブル類を接続する前に、次の要領で人体およびテスト・ケーブルから静電気帯電を除去してください。

- ケーブルの取り付けまたは取り外しの際には、接地された帯電防止リスト・ストラップを付けて、人体から静電気を放電します。
- 未接続で放置されたままのケーブルは、大量の静電気を帯びている可能性があります。すべてのケーブルは機器やテスト対象デバイスに接続する前に、ケーブルの中心導体を一時的に接地するか、ケーブルの一端を 50 Ω ターミネータに接続して放電します。

## コントロール

### 電源ボタン

項目	概要
	<p>この電源ボタンにより、電源のオン・オフを切り替えます。電源が接続されると同時に、機器の一部は常時オンになり、ボタン上部の赤い LED が点灯します。このとき電源ボタンを押すと、機器の電源がオンになります。</p>



### 測定ボタン




測定ボタンを使用して、測定を選択および表示を行います。

項目	概要
	<p><b>Meas</b> ボタンは、画面の下部に機器の測定メニューを表示します。メニュー項目の直下にあるメニュー・ボタンを押してそのメニュー項目を選択すると、必要に応じてサブメニューが開きます。一般的な測定項目には、周波数、周期、時間、パルス、位相、積算 (FCA3100 シリーズのみ)、および電圧があります。使用できるメニュー項目は、機器の型式および構成によって異なります。</p>
	<p><b>Value</b> ボタンは、現在の測定値を数値で表示します。本器の画面下部には補足的な測定値も表示されます。</p>
	<p><b>Analyze</b> ボタンは、現在の測定値を次の 3 つの統計解析表示モードの 1 つで表示します。Analyze ボタンを繰り返し押しすると、統計表示モードが切り替わります。</p> <ul style="list-style-type: none"> <li>■ <b>数値表示</b>: 統計データが数値データとして表示されます。統計データのリードアウトには、Mean (メイン測定値の N サンプルの移動平均値)、Max (最大値)、Min (最小値)、P~P (ピーク間偏差)、Adev (アラン偏差)、および Std (標準偏差) があります。(10 ページ「数値表示」参照)。</li> <li>■ <b>ヒストグラム表示</b>: 連続したメイン測定値をヒストグラムとして表示します。ヒストグラムのピンは、測定データに基づいてオートスケールされます。アクティブな場合はリミット値、および移動平均値 X が縦の点線で表示され、グラフの中央は X 軸上の塗りつぶしの三角形で示されます。プロットの下に沿って、プロットのスケール・ファクタ、プロットの中央測定値、および測定完了率の値が表示されます。リミット値を設定すると、オートスケールが変化して、現在の測定値と設定されているリミット値を同時に表示します。(10 ページ「ヒストグラム表示」参照)。</li> </ul> <p><b>Settings &gt; Stat &gt; No. Of Samples</b> メニューを使用して、水平軸に沿ったピン数を設定します。</p> <ul style="list-style-type: none"> <li>■ <b>トレンド・プロット表示</b>: 連続したメイン測定値をトレンド・プロットとして表示します。このモードは、周期的な変動や傾向の観察に便利です。トレンド・プロットは、測定データを元にオートスケールされ、リスタート時には 0 から開始されます。リミット (アクティブな場合) は水平の実線で示されます。(11 ページ「トレンド・プロット表示」参照)。</li> </ul>
	<p><b>Auto Set</b> ボタンは、測定機能のトリガ・レベルおよび入力信号の振幅を自動的に設定します (標準的な信号の場合)。この機能により、本器の測定表示をすばやく設定できます。</p> <p>Auto Set ボタンを 2 秒以内に 2 回押しすると、機器の多くの設定 (測定時間、演算、フィルタ、およびアーミング) がデフォルト値にリセットされます。これは測定機能やテストのセットアップの変更時に生じがちなロックアップを防いだり、解釈を誤らないようにするためのものです。</p>



## ナビゲーション・ボタン

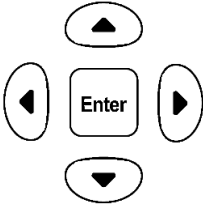
ナビゲーション・ボタンを使用して、メニュー項目の選択、設定数値の増減、および数値のクリアを行います。

項目	概要
	<p>ナビゲーション・ボタンは、以下のモードによって異なった機能を提供します。</p> <p><b>メニュー・モード:</b> 左矢印、右矢印、および Enter の各ボタンを使用して、メニュー項目の表示と選択を行います (キーパッドのメニュー選択ボタンと同様の機能)。</p> <p><b>数値入力モード:</b> 左矢印ボタンは、設定フィールドの右端の桁をクリアします。上下の矢印ボタンを使用して、設定フィールドの数値を増減します (1-2-5 のパターンで)。</p> <p><b>Enter</b> ボタンは、表示された値またはメニューを確定して、前のメニューに戻ります。機器にメニューや入力プロンプトが表示されない場合は、上下の矢印ボタンで LCD 画面のコントラストを設定します。</p>
	<p><b>Save/Exit</b> ボタンは、現在の選択を確定して終了し、前のメニュー・レベルに戻ります。</p>
	<p><b>Esc</b> ボタンは、現在の選択を確定せずに前のメニュー・レベルに戻ります。</p>

## キーパッド・ボタン
 
<b>1</b>	<b>2</b>	<b>3</b>	<b>4</b>	<b>5</b>		
<b>6</b>	<b>7</b>	<b>8</b>	<b>9</b>	<b>0</b>	.	±
Input A	Input B	Settings	Math/Limit	User Opt	Hold/Run	Restart

キーパッド・ボタンを使用してメニュー項目を選択し、設定値を入力します。

項目	概要
数値ボタン	1 ~ 0、.、および ± ボタンで、数値パラメータの値を入力します。
メニュー選択ボタン	キーパッド・ボタンの上の列 (1 ~ 5 および 2 つのブランク・ボタン) で、対応する画面メニュー項目を選択します。
メニュー・アクセス・ボタン	キーパッド・ボタンの下の列 (6 ~ 0) で、ボタンのメニュー (Input A、Input B、Settings、など) が表示されます。
	<p><b>Input A</b> または <b>Input B</b> ボタンで、選択したチャンネルの入力チャンネル構成メニューを表示します。</p> <p>Input A および Input B のメニューではチャンネル関連の設定が可能で、トリガ・スロープ、信号カップリング (AC または DC)、入力インピーダンス (50 Ω または 1 MΩ)、入力減衰 (1× または 10×)、トリガ・モード (手動または自動)、トリガ・レベル、およびフィルタ (カットオフ周波数) が設定できます。</p>


項目	概要
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; width: 20px; height: 20px; text-align: center; line-height: 20px;">8</div> Settings	<p><b>Settings</b> ボタンは測定の構成メニューを表示します。</p> <p>Settings メニューでは測定関連の設定が可能で、測定時間(周波数測定用)、バースト(パルス変調信号用)、アーミング(条件付き測定開始/停止)、トリガ・ホールドオフ(停止トリガ遅延)、統計(サンプル数など統計測定の設定)、タイム・ベースのリファレンス(内部または外部)、その他(入力信号タイムアウト期間および自動トリガの低周波設定など)が設定できます。</p> <p>これらの機器のメニューおよび設定の詳細情報は、『FCA3000 シリーズおよび MCA3000 シリーズ・ユーザ・マニュアル』を参照してください。</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; width: 20px; height: 20px; text-align: center; line-height: 20px;">9</div> Math/Limit	<p><b>Math/Limit</b> ボタンは、演算およびリミット・テストの構成メニューを表示します。</p> <p>演算メニューでは、測定結果を数学的に後処理するために、定義済みの式やユーザ定義の定数を提供します。一般的な演算処理の使用目的としては、テスト対象信号の一部のミキサやマルチプライヤを考慮した測定結果の変換などが挙げられます。</p> <p>リミット・メニューでは、数値リミットを設定し、リミット違反を報告する方法を選択します。</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; width: 20px; height: 20px; text-align: center; line-height: 20px;">0</div> User Opt	<p><b>User Opt</b> ボタンは、ユーザ・オプションの構成メニューを表示します。</p> <p>User Options メニューでは機器の設定が行えます。機器のセットアップの保存や呼び出し(工場出荷時のデフォルトまたは不揮発メモリに最大 20 のユーザセットアップを固有のラベル付きで)、バス・インタフェースの選択(USB または GPIB)、GPIB バスの構成(モード、アドレス)、機器のセルフテスト、条件付きパルス出力信号のセットアップ(FCA3100 シリーズのみ)、および機器の構成情報(型式、シリアル番号、ファームウェア、および構成)の設定が可能です。</p> <p>User Options メニューでは、機器の校正もあわせて行えます。この内部校正プロセスを実行するには、パスワードの入力が必要になります。内部校正プロセスを実行する手順の詳細については、『MCA3000 シリーズ・マイクロ波カウンタ/アナライザ・テクニカル・リファレンス・マニュアル』を参照してください。</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; width: 20px; height: 20px; text-align: center; line-height: 20px;">.</div> Hold/Run	<p><b>Hold/Run</b> ボタンは、測定の実行を制御します。このボタンを押して、実行(常に測定値を取得)モードおよびホールド(測定の一時的停止)モードを切り替えます。</p> <p>機器が測定のホールド・モードになると、画面の右上の測定インジケータが MEAS から HOLD に変わります。Hold/Run ボタンをもう一度押すと、通常の(連続)測定モードに戻ります。</p> <p>ホールド・モードの状態では、Restart ボタンを押すと、単発の測定が行えます。シングル測定の実行中、画面右上の測定インジケータは HOLD から SING に変わります。</p>
<div style="border: 1px solid black; border-radius: 5px; padding: 2px; display: inline-block; width: 20px; height: 20px; text-align: center; line-height: 20px;">±</div> Restart	<p><b>Restart</b> ボタンは、測定値をゼロに戻して測定を再度行います。これは、特に測定時間の長い場合に、入力信号を変えた後で新しい測定を開始する場合に便利です。</p> <p>単発の測定を行うには、Hold/Run を押して機器をホールド・モードにし(測定インジケータが MEAS から HOLD に変化)、次に Restart ボタンを押します。測定インジケータが HOLD から SING に変わり、測定が行われ、インジケータが HOLD に戻ります。</p> <p>Restart は機器の他の設定には影響を及ぼしません。</p>

## メイン画面

本器はモノクロ LCD を使用し、信号ソース、測定値 (数値およびグラフィカル)、およびメニュー項目を表示します。表示される項目は、表示モードによって異なります。

### 測定値モード


Value ボタンを押してこのモードを有効にし、現在の測定値について高分解能の数値リードアウトを表示します。

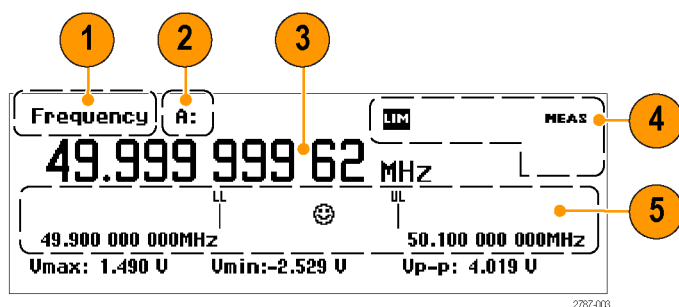

1. 現在の測定項目です。
2. 測定信号ソースです。
3. メイン測定リードアウト。画面の下部のリードアウトは、ソース信号の電気的情報を表します。リードアウトや表示は測定や解析のモードによって変わります。
4. 測定ステータス。演算またはリミット・テスト・モード (MATH または LIM)、測定ステータス (MEAS、HOLD、または SING)、また機器が GPIB バスからリモート・コントロールされているか (REM) を表示します。測定ステータスはすべての表示モードで表示されます。
5. リミット・アラームのリードアウト (アクティブな場合)。下限 (LL) および上限 (UL) の設定は、関連のリミット値と併せて垂直バーで表示されます。顔文字は、相対的な測定値およびリミットの合 / 不合格のステータスを示します (測定値がリミット内の場合は笑顔、測定値がリミットを超えた場合はしかめ顔)。測定値がリミットを超えると画面最上部の LIM ステータス・テキストが点滅し、測定値がリミット内に戻っても点滅し続けます。LIM インジケータをリセットするには、**Restart** ボタンを押します。

## メニュー・モード

メニュー・ボタン (Meas, Input A, Input B, Settings, Math/Limit, User Opt) を押すと、画面の下部がそのボタンのメニュー項目に置き換わります。次の図は、Meas ボタンのメニュー項目を示しています。

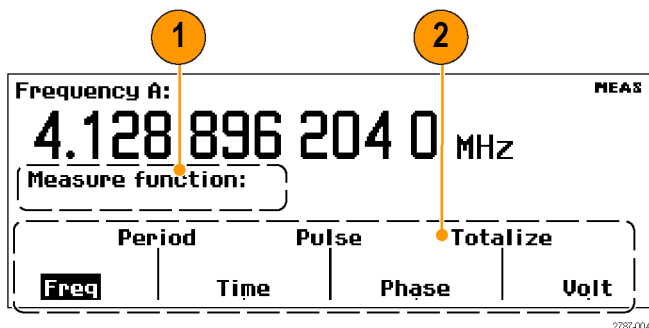


1. パス領域には、現在のメニュー選択のメニュー・パスが表示されます。
2. メニュー領域には、使用可能なメニュー・オプションが表示されます。メニュー項目のすぐ下のキーパッド・ボタンを押すとその項目が選択されるか、またはその下位レベルのメニューが表示されます。選択されている項目は反転文字で表示されます。ナビゲーション・ボタンを使用しても、メニュー項目のハイライトや選択が行えます。

## 解析モード


解析モード (Analyze ボタンを繰り返し押してアクセス) では、測定値に基本統計解析を適用して、数値、ヒストグラム、またはトレンド・プロットの統計解析リードアウトを表示します。

**数値表示:** 連続して測定を行い、結果を数値統計リードアウトとして表示します。

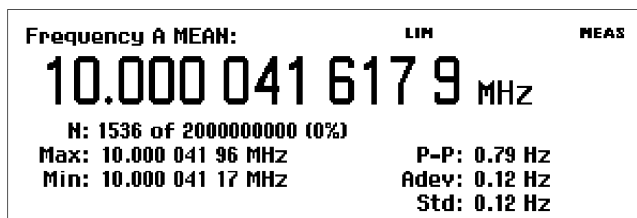


- MEAN: メイン測定値は、N サンプルの移動平均を示します。
- N: 測定サンプル数 (Settings > Stat メニューで設定)
- Max、Min: 測定の最大値と最小値
- P~P: ピーク間偏差
- Adev: アラン偏差
- Std: 標準偏差

**ヒストグラム表示:** 連続した測定値をヒストグラムとして表示します。水平方向のビンの数は、Settings > Stat メニューで設定します。

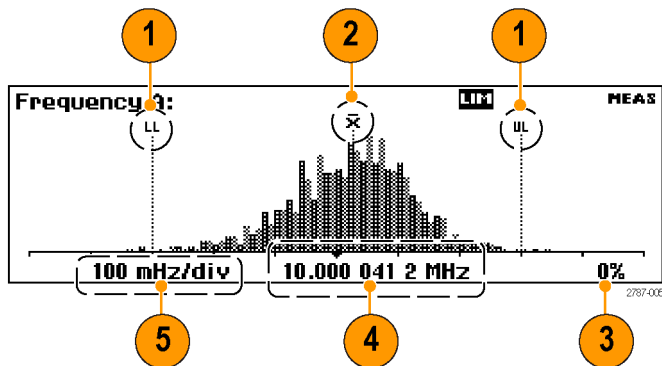

1. Limits Alarm の上限および下限レベル (アクティブな場合)。リミット・テストがアクティブな場合、グラフはオートスケールされヒストグラムとリミットの両方が表示されるようにします。オートスケールにはリミット内のデータのみが使用され、グラフの表示領域外の測定値はディスプレイの左端または右端に矢印で示されます。
2. 移動平均測定値 ( $\bar{X}$ )
3. 完了した測定のパーセンテージ
4. グラフの中央 (黒い三角マーク) およびその周波数
5. グラフ目盛の水平スケール。Limits Alarm (アクティブな場合) は、現在の測定値とリミット設定の両方を表示するようにスケールが設定されます。測定したデータに基づいて、ヒストグラムのビンが連続的にオートスケールされます。

**トレンド・プロット表示:** 連続した測定を行い、値の時間変化をプロットします。このモードは、変動や測定値の偏差トレンドの観察に便利です。設定されたサンプル数が完了すると、トレンド・プロットは停止 (Hold がアクティブな場合) またはリスタート (Run がアクティブな場合) します。トレンド・プロットのグラフは、測定データを元に連続的にオートスケールされ、リスタート時には 0 から開始されます。Limit Alarms がアクティブな場合は、水平線で表示されます。

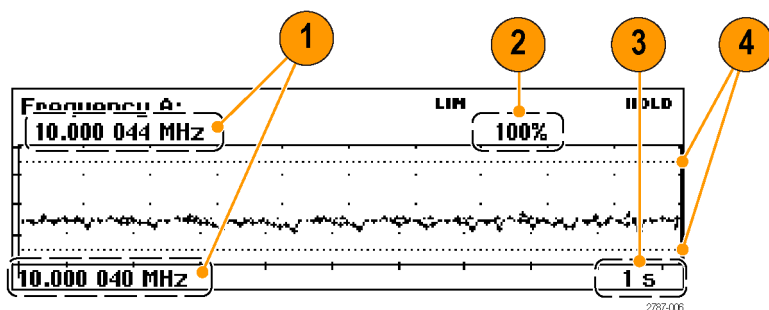

1. プロット表示の周波数レンジの上限と下限。トレンド・プロット・グラフは、測定したデータに基づいて、測定トレンド値を示すためにオートスケールされます。
2. 完了した測定のパーセンテージ
3. 目盛の水平方向の単位
4. Limits Alarm レベル (アクティブな場合)。リミット・テストがアクティブな場合、測定トレンド・プロットとリミット値 (水平の破線) の両方を示すために、グラフのスケールが設定されます。

## 使用例

特に断りがない限り、本セクションの例では、1 MHz の信号、50 Ω のケーブルを使用して機器に接続された 5 V<sub>pp</sub> 方形波のソース、入力信号レベルおよび周波数は許容範囲であると仮定します。

### デフォルト設定のリストア


1. User Opt > Save/Recall > Setup > Recall Setup > Default を押して機器のデフォルトの設定を呼び出します (ロード)。デフォルトで、Frequency 測定が表示されます。




### 基本的な測定

必要条件: 機器をデフォルト設定にリセットします。(12 ページ「デフォルト設定のリストア」参照)。

1. Meas を押して、Measurement メニューを開きます。
2. メニュー項目の下のメニュー・ソフトキーを使用して、測定項目を選択します。

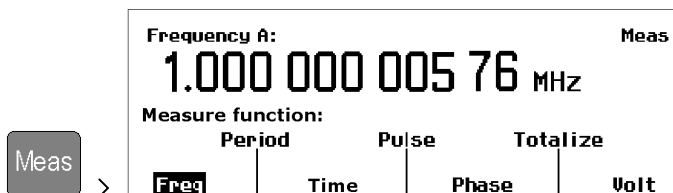

例えば、Period > Single > A を選択して、Input A の周期測定を表示します。

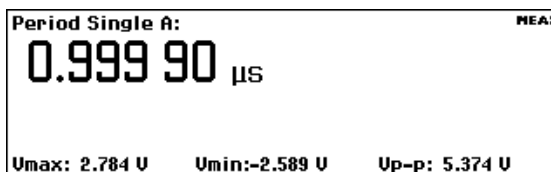




## 演算測定

本器内の演算機能により、スケーリングおよびオフセットなどのポストプロセス操作を測定結果に適用できます。この使用例の1つが、目標値からの偏差の表示です。これはオフセットとして知られています。式内の値  $X$  は機器の測定値を表しています。


必要条件: 機器をデフォルト設定にリセットします。(12 ページ「デフォルト設定のリストア」参照)。

1. **Math/Limit** を押して **Math** と **Limits** のメニューを表示します。


9  
Math/Limit >

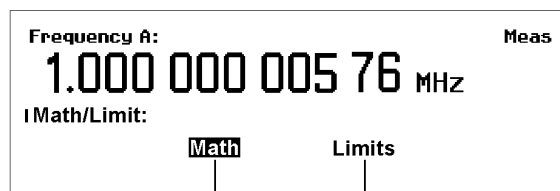


2. **Math** > **Math Off** > **(K\*X+L)/M** を選択します。

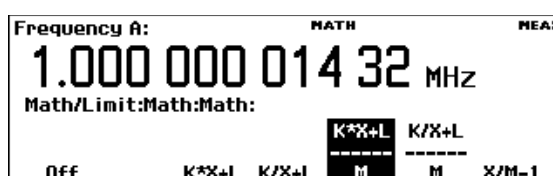

3. **L** を選択して、**-1 EE6** と入力します。

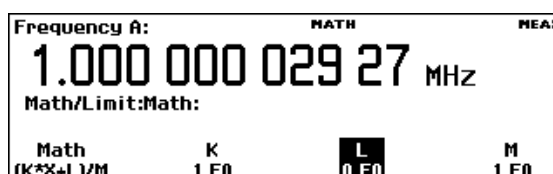

4. **Save/Exit** を繰り返し押してメニュー・レベルを終了し、測定のリードアウトに戻ります。1 MHz からの周波数偏差が表示されます(このケースでは、29.91 milliHertz)。

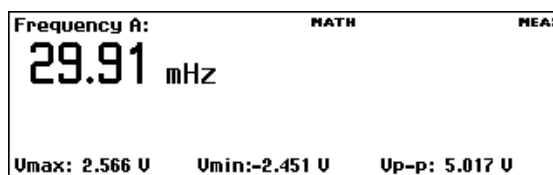


## リミット・テスト

この例では周波数リミットをテストしますが、テスト・リミットは多くの測定項目で設定可能です。

1. 機器をデフォルト設定にリセットします。(12 ページ「デフォルト設定のリストア」参照)。
2. **Math/Limit** を押して **Limits** を選択します。

9  
Math/Limit >

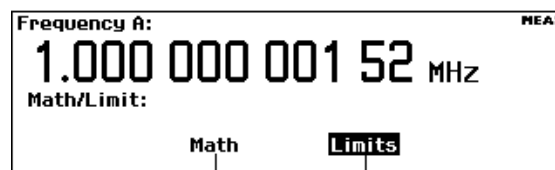

3. **Limit Behavior Off** を押して、**Alarm\_Stop** を選択します。前のメニューに戻り、Limit Behavior メニューのラベルが Alarm\_Stop に変わります。



4. Limit Mode が **Range** に設定されていることを確認します。




5. **Lower Limit** を選択し、測定の下限值を入力します。**Enter** または **Save/Exit** を押して値を確定します。このステップを繰り返して、**Upper Limit** 値を設定します。



Math/Limit:Limits:

Lower Limit: 1.00000001 EE6

6. **Save/Exit** を繰り返し押し続けてメニュー・システムを終了し、測定表示に戻ります。次に **Restart** を押します。

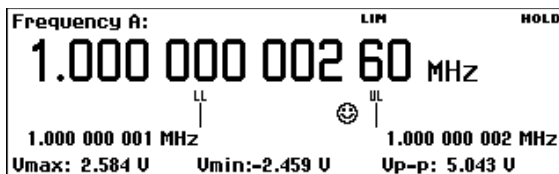

レンジ・モードにおけるリミット・テストのリードアウトでは垂直ラインで下限値と上限値を表し、顔文字により測定がリミット内かリミット外かを示します。


表示リミット外の測定値では、しかも面の顔文字が表示され、LIM ステータス・インジケータが点滅します。



リミット・テストのスケール外の測定は、画面の左端または右端の矢印で示されます。本機器ではリミット内のデータのみを使用してオートスケールされます。



7. リミット設定を他のリードアウトに追加して表示することもできます。例えば、ヒストグラムのリードアウトが表示されるまで、**Analyze** ボタンを繰り返し押します。

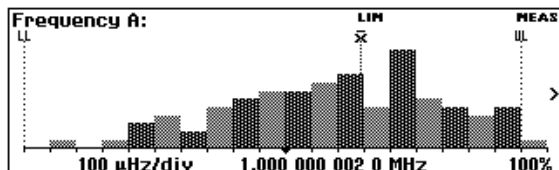

- リミット・テストを停止(無効)にするには、**Math/Limit > Limit Behavior > Off** を押します。


## 2 チャンネルの測定

必要条件: 機器をデフォルト設定にリセットします。(12 ページ「デフォルト設定のリストア」参照)。

- Input A** および **Input B** のボタンを押して、測定に適した設定であることを確認します。この例では、入力設定は同じ内容です。
- 信号を入力 A および B に接続します。
- Meas** を押して、**Phase > B Rel A** を選択します。A 入力と比較した B 入力の位相差が表示されます。



- Meas** を押して、**Time > Time Interval > A to B** を選択します。Input A の立上りエッジから Input B の立上りエッジまでのタイム・インターバルが表示されます。

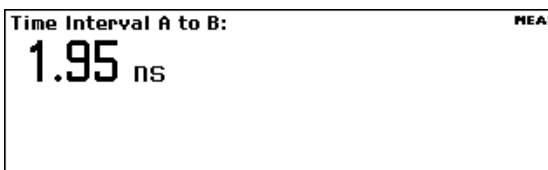

## Input C の測定

Input C 高周波プリスケラを持つ機器 (FCA3000 シリーズ、FCA3100 シリーズ) またはダウン・コンバータを持つ機器 (MCA3000 シリーズ) では、C 入力の測定サブセットが使用可能です。これらの測定項目は、周波数、周波数レシオ (C と A、および C と B)、周波数バースト、および周期 (平均) です。機器のメニューに Input C が追加されます。


通常の手順で Input C の測定を行います。Input C での測定に関する詳細は、『FCA3000 シリーズ、FCA3100 シリーズ、および MCA3000 シリーズ・ユーザ・マニュアル』を参照してください。

## 機器の設定値の保存


機器では、20 の設定情報を不揮発メモリに保存することができます。測定項目の設定、トリガ・レベル、演算の定数などを含めたすべての機器パラメータが保存されます。保存するセットアップごとに固有の識別子でラベルを付けることができます(最長 7 文字)。

**注:** デフォルトの機器設定を復元しても、メモリに保存された設定が消去されることはありません。

1. 保存したい構成に機器を設定します。
2. **User Opt > Save/Recall > Setup > Save Current Setup** を押します。

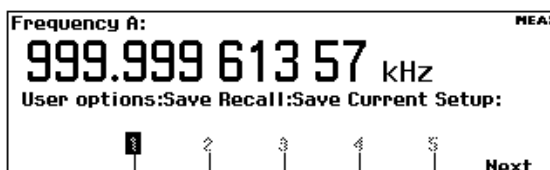


 3. 使用可能なメモリ位置(黒いフォント番号で示す)が表示されるまで、**Next** を選択します。空または使用できないメモリ位置はグレーの文字で示されます。
4. **メニュー・キー**を押して、メモリの番号を選択します。





**注:** 内容を誤って上書きするのを防ぐために、セットアップ・メモリの 1 ~ 10 はデフォルトで保護されています。セットアップ・メモリの保護に関する詳細は、**ユーザ・マニュアル**を参照してください。

5. **メニューのソフトキー**を使用して、機器の設定ファイルにラベルを入力します(最長 7 文字)。デフォルトのラベルは現在の測定を元に生成されたものです。
6. **ナビゲーション・ボタン**を使用して、挿入カーソルを移動します。
7. **Enter** または **Save/Exit** を押してラベル・テキストを確定し、機器の設定を保存します。

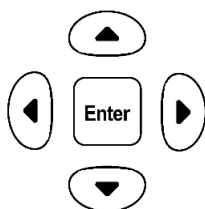

## セットアップの呼び出し

1. User Opt > Save/Recall > Setup > Recall Setup を押します。
2. Next メニュー・ボタンを押して、機器のセットアップを呼び出すメモリを表示します。空の場所はグレーの文字で示されます。
3. セットアップ・メモリのメニュー・ボタンを押します。セットアップがロードされ、そのセットアップに基づいた測定項目が表示されます。

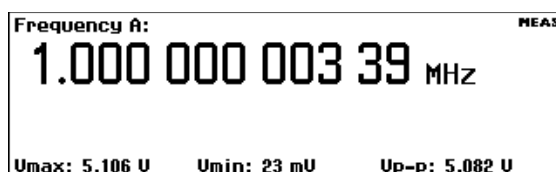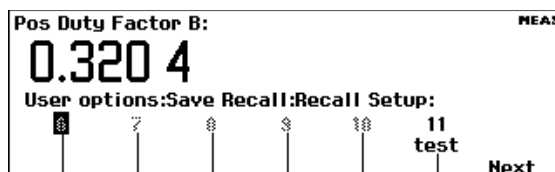

## 拡張性

FCA3000、FCA3100、および MCA3000 の各シリーズのベンチ機器に備わる高速 USB および GPIB バスを利用すると、当社専用エディションの National Instruments LabVIEW SignalExpress ソフトウェアを使用して、測定結果の収集、保存、および解析がすばやく簡単に行えます。すべての機器には、基本的な機器のコントロール、データ・ロギング、および解析が可能な SignalExpress のテクトロニクス・バージョンの無償コピーが付属しています。オプションの完全版では、詳細な信号処理、拡張解析、掃引、リミット・テスト、およびユーザによるステップ定義など、200 以上の機能を備えています。

SignalExpress は当社のすべてのベンチ機器を接続でき、各機器のさまざまな機能に、単一の直感的なソフトウェア・インタフェースを介してアクセスすることができます。単一のインタフェースにより、複数の機器を必要とする複雑な測定、複数の機器の時間相関データ、長時間にわたるデータ・ロギングを自動化することができます。結果を簡単に収集し解析することができます。これらすべてを手元の PC から操作することが可能です。

オプションの TimeView™ Modulation Domain Analysis PC ソフトウェア・アプリケーション (TVA3000) を使用すると、機器のリモート・コントロールが可能になり、測定結果の解析と表示がグラフの選択だけで行えます。変調、ジッタ、ワンダ、スイープの線形性、周波数可変型通信、ワイヤレス LAN、Bluetooth 周波数ホッピング、VCO 周波数応答など、時間と周波数に関するほぼすべてのダイナミック変動が解析できます。例えば、結果を生データ、統計ヒストグラム、波形グラフ (オシロスコープを使用しているかのように)、また FFT のスペクトル・グラフとして表示できます。TimeView ではさらに、変調度や周波数変調指数などの変調パラメータの解析も行えます。TimeView は、当社 Web サイト ([www.tektronix.com](http://www.tektronix.com)) から 30 日間のトライアル版をダウンロードできます。

FCA3000 和 FCA3100 系列定时器/计数器/分析仪  
MCA3000 系列微波计数器/分析仪  
快速入门用户手册



071-2789-02

**Tektronix**





**FCA3000 和 FCA3100 系列定时器/计数器/分析仪**  
**MCA3000 系列微波计数器/分析仪**  
**快速入门用户手册**

Copyright © Tektronix. 保留所有权利。许可软件产品由 Tektronix、其子公司或提供商所有，受国家版权法及国际条约规定的保护。

Tektronix 产品受美国和外国专利权（包括已取得的和正在申请的专利权）的保护。本文中的信息将取代所有以前出版的资料中的信息。保留更改技术规格和价格的权利。

TEKTRONIX 和 TEK 是 Tektronix, Inc. 的注册商标。

LabVIEW、National Instruments、NI 和 SignalExpress 是 National Instruments 的商标。

TimeView 是 Pendulum Instruments AB 的商标。

## **Tektronix 联系信息**

Tektronix, Inc.  
14150 SW Karl Braun Drive  
P.O. Box 500  
Beaverton, OR 97077  
USA

有关产品信息、销售、服务和技术支持：

- 在北美地区，请拨打 1-800-833-9200。
- 其他地区用户请访问 [www.tektronix.com](http://www.tektronix.com)，以查找当地的联系信息。

## 保证声明

Tektronix 保证，本产品自发货之日起三 (3) 年内不会出现材料和工艺缺陷。如果在保修期内证明任何此类产品有缺陷，Tektronix 将会选择对缺陷产品进行维修或更换，不收部件和人工费用。Tektronix 作保证用途的部件、模块和更换产品可能是全新的，或者经修理具有相当于新产品的性能。所有更换的部件、模块和产品将成为 Tektronix 的财产。

为得到本保证声明承诺的服务，客户必须在保修期内向 Tektronix 通报缺陷，并为服务的履行做适当安排。客户应负责包装缺陷产品并托运到 Tektronix 指定的维修中心，同时预付运费。如果产品运送到 Tektronix 维修中心所在国之内的地点，Tektronix 应支付向客户送返产品的费用。如果产品送返到任何其他地点，客户应负责支付所有的运费、关税、税金及任何其他费用。

本保证声明不适用于由于使用不当或者维护保养不当或不足所造成的任何缺陷、故障或损坏。Tektronix 在本保证声明下没有义务提供以下服务：a) 修理由非 Tektronix 服务代表人员对产品进行安装、修理或维护所导致的损坏；b) 修理由于使用不当或与不兼容的设备连接造成的损坏；c) 修理由于使用非 Tektronix 提供的电源而造成的任何损坏或故障；d) 维修已改动或者与其他产品集成的产品（如果这种改动或集成会增加产品维修的时间或难度）。

本保证由 TEKTRONIX 关于本产品而订立，用于替代任何其他的明示或暗示的保证。TEKTRONIX 及其供应商拒绝对用于特殊目的的适销性或适用性做任何暗示的保证。对于违反本保证的情况，TEKTRONIX 负责修理或更换有缺陷产品是提供给客户的唯一和独有的补救措施。无论 TEKTRONIX 及其供应商是否被预先告知可能发生任何间接、特殊、意外或引发的损坏，TEKTRONIX 及其供应商对这些损坏都不负有责任。

[W4 - 15AUG04]



# 目录

重要安全信息 .....	iii
常规安全概要 .....	iii
维修安全概要 .....	iv
本手册中的术语 .....	v
产品上的符号和术语 .....	v
合规性信息 .....	vi
EMC 符合性 .....	vi
安全符合性 .....	vii
环境注意事项 .....	viii
前言 .....	ix
主要功能 .....	ix
文档 .....	x
本手册中使用的约定 .....	x
安装 .....	1
打开仪器包装 .....	1
操作注意事项 .....	1
接通和断开仪器电源 .....	2
功能检查 .....	2
认识仪器 .....	3
前面板 .....	3
后面板 .....	4
输入连接器 .....	5
控件 .....	5
主屏幕 .....	9
应用示例 .....	12
恢复默认设置 .....	12
基本测量 .....	12
数学测量 .....	13
极限测试 .....	13
双通道测量 .....	15
输入 C 测量 .....	15
保存仪器设置 .....	16
连接能力 .....	18



## 重要安全信息

本手册包含用户必须遵守的信息和警告，以确保安全操作并保证产品安全。

为保证安全地对本产品进行维修，本部分结尾还提供其他信息。（见第iv页，*维修安全概要*）

## 常规安全概要

请务必按照规定使用产品。详细阅读下列安全性预防措施，以避免人身伤害，并防止损坏本产品或与本产品连接的任何产品。认真阅读所有说明。保留这些说明以备将来参考。

遵守当地和国家安全法令。

为了保证正确安全地操作产品，除本手册规定的安全性预防措施外，您还必须遵守普遍公认的安全规程。

产品仅限经过培训的人员使用。

只有了解相关危险的合格人员才能进行开盖维修、保养或调整。

使用前，请务必检查产品是否来自已知来源，以确保正确操作。

本产品不适用于检测危险电压。

如果有危险的带电导体暴露，请使用个人防护装备以防电击和强电弧伤害。

使用本产品时，您可能需要使用一套大型系统的其他部件。有关操作这类系统的警告和注意事项，请阅读其他组件手册的安全性部分。

将本设备集成到某系统时，该系统的安全性由系统的组装者负责。

## 避免火灾或人身伤害

**使用合适的电源线：**只使用本产品专用并经所在国家/地区认证的电源线。

不要使用为其他产品提供的电源线。

**将产品接地：**本产品通过电源线的接地导线接地。为避免电击，必须将接地导线与大地相连。在对本产品的输入端或输出端进行连接之前，请务必将本产品正确接地。

不要切断电源线的接地连接。

**断开电源：**电源线可以使产品断开电源。请参阅有关位置的说明。请勿将设备放在难以接近电源线的位置；必须保证用户可以随时操作电源线，以在需要时快速断开连接。

**正确连接并正确断开连接：**探头或测试导线连接到电压源时请勿插拔。

**遵守所有终端额定值：**为避免火灾或电击危险，请遵守产品上所有的额定值和标记说明。在连接产品之前，请先查看产品手册，了解额定值的详细信息。

对任何终端（包括公共终端）施加的电压不要超过该终端的最大额定值。

本产品的测量端子额定值不适用于连接到市电或 II、III 或 IV 类型电路。

**切勿开盖操作：**请勿在外盖或面板拆除或机壳打开的状态下操作本产品。可能有危险电压暴露。

**远离外露电路：** 电源接通后请勿接触外露的接头和元件。

**怀疑产品出现故障时，请勿进行操作：** 如果怀疑本产品已损坏，请让合格的维修人员进行检查。

产品损坏时请勿使用。本产品损坏或运行错误时请勿使用。如果怀疑产品存在安全问题，请关闭产品并断开电源线。并做清晰标记以防其再被使用。

仅使用规定的替换部件。

**使用合适的保险丝：** 只能使用为本产品指定的保险丝类型和额定值。

**请勿在潮湿环境下操作：** 请注意，如果某个单元从冷处移到暖处，则可能发生凝结情况。

**请勿在易燃易爆的环境下操作：**

**请保持产品表面清洁干燥：** 在清洁本产品时，请先拔掉输入信号线。

**请适当通风：** 有关如何安装产品使其保持适当通风的详细信息，请参阅手册中的安装说明。

所提供的狭槽和开口用于通风，不得遮盖或阻挡。请勿将物体放进任何开口。

**提供安全的工作环境：** 始终将产品放在方便查看显示器和指示器的地方。

请确保工作区符合适用的人体工程学标准。请咨询人体工程学专家，以避免应激损伤。

## 维修安全概要

维修安全概要部分包含安全执行维修所需的其他信息。只有合格人员才能执行维修程序。在执行任何维修程序之前，请阅读此维修安全概要和常规安全概要。

**避免电击：** 接通电源时，请勿触摸外露的连接。

**不要单独维修：** 除非现场有他人可以提供急救和复苏措施，否则请勿对本产品进行内部维修或调整。

**断开电源：** 为避免电击，请先关闭仪器电源并断开与市电电源的电源线，然后再拆下外盖或面板，或者打开机壳以进行维修。

**带电维修时要格外小心：** 本产品中可能存在危险电压或电流。在卸下保护面板，进行焊接或更换元件之前，请先断开电源，卸下电池（如适用）并断开测试导线。

**维修之后验证安全性：** 请务必在维修后重新检查接地连续性和市电介电强度。



## 本手册中的术语

本手册中可能使用以下术语：



**警告：**“警告”声明指出可能会造成人身伤害或危及生命安全的情况或操作。



**注意：**“注意”声明指出可能对本产品或其他财产造成损坏的情况或操作。

## 产品上的符号和术语

产品上可能出现以下术语：

- “危险”表示您看到该标记时可直接导致人身伤害的危险。
- “警告”表示您看到该标记时不会直接导致人身伤害的危险。
- “注意”表示会对本产品或其他财产造成损害的危险。



产品上标示此符号时，请确保查阅手册，以了解潜在危险的类别以及避免这些危险需采取的措施。（此符号还可能用于指引用户参阅手册中的额定值信息。）

产品上可能出现以下符号：



CAUTION  
Refer to Manual



Protective Ground  
(Earth) Terminal



Chassis Ground



Standby

## 合规性信息

此部分列出仪器遵循的 EMC（电磁兼容性）、安全和环境标准。

### EMC 符合性

#### EC 一致性声明 - EMC

符合 Directive 2004/108/EC 有关电磁兼容性的要求。已证明符合《欧洲共同体公报》中所列的以下技术规格：

**EN 61326-1、EN 61326-2-1:** 测量、控制和实验室用电气设备的 EMC 要求。 <sup>1 2 3</sup>

- CISPR 11; IEC 61000-4-2; IEC 61000-4-3 <sup>4</sup>; IEC 61000-4-4; IEC 61000-4-5; IEC 61000-4-6 <sup>4</sup>; IEC 61000-4-11 <sup>5</sup>

**EN 61000-3-2, EN 61000-3-3:**

#### 欧洲联系方式:

Tektronix UK, Ltd.  
Western Peninsula  
Western Road  
Bracknell, RG12 1RF

- 1 本产品仅在非居民区内使用。在居民区内使用可能造成电磁干扰。
- 2 当该设备与测试对象连接时，可能产生超过此标准要求的辐射级别。
- 3 为确保符合上面列出的 EMC 标准，应使用高质量的屏蔽接口电缆。
- 4 如果在 A 或 B 输入通道上施加 10 MHz 0.1 V<sub>p-p</sub> 正弦波信号，则当仪器置于 IEC 61000-4-3 和 IEC 61000-4-6 测试中定义的磁场和信号环境时，仪器的频率读数通常可超出固有基准方差，达到 ±1 Hz 的差异。
- 5 性能标准 C 应用于 70%/25 周期电压跌落以及 0%/250 周期电压中断测试水平（IEC 61000-4-11）。

#### 澳大利亚/新西兰一致性声明 – EMC

根据 ACMA，符合 Radiocommunications Act（无线电通信法）有关 EMC 规定的以下标准：

- CISPR 11

#### 澳大利亚/新西兰联系方式:

Baker & McKenzie  
Level 27, AMP Centre  
50 Bridge Street  
Sydney NSW 2000, Australia（澳大利亚）

## 安全符合性

本部分列出了产品遵循的安全标准及其他安全合规性信息。

### EU 一致性声明 - 低电压

经证明符合《欧洲共同体官方公报》中所列的以下技术规范：

- 低电压指令 2006/95/EC。
- EN 61010-1

### 美国国家认可的测试实验室列表

- UL 61010-1

### 加拿大认证

- CAN/CSA-C22.2 No. 61010-1

### 其他符合性

- IEC 61010-1

### 设备类型

测试和测量设备。

### 安全级别

1 级 - 接地产品。

### 污染度评级

污染度 2（如 IEC 61010-1 中定义）。仅适合在室内的干燥场所使用。

### 主线过压类别额定值

过压类别 II（如 IEC 61010-1 中的定义）。

## 环境注意事项

本部分提供有关产品对环境影响的信息。

### 产品报废处理

回收仪器或元件时，请遵守下面的规程：

**设备回收：**生产本设备需要提取和使用自然资源。如果对本产品的报废处理不当，则该设备中包含的某些物质可能会对环境或人体健康有害。为避免将有害物质释放到环境中，并减少对自然资源的使用，建议采用适当的方法回收本产品，以确保大部分材料可以得到恰当的重复使用或回收。



此符号表示该产品符合欧盟有关废旧电子和电气设备 (WEEE) 以及电池的 2012/19/EU 和 2006/66/EC 号指令所规定的相关要求。有关回收方式的信息，请查看 Tektronix 网站 ([www.tektronix.com](http://www.tektronix.com)) 上的 Support/Service (支持/服务) 部分。

### 有害物质限制

本产品属于工业监视和控制仪器，并且无须符合 RoHS 指令 2011/65/EU 重订版的物质限制要求（截至 2017 年 7 月 22 日）。

## 前言

本手册介绍了 FCA3000 系列、FCA3100 系列及 MCA3000 系列仪器的安装和基本操作。有关详细信息，请参阅《FCA3000 系列、FCA3100 系列和 MCA3000 系列用户手册》（产品光盘上的 PDF 文件）。本手册适用于以下仪器：

- FCA3000 系列：FCA3000、FCA3003 和 FCA3020
- FCA3100 系列：FCA3100、FCA3103 和 FCA3120
- MCA3000 系列：MCA3027 和 MCA3040

## 主要功能

- 测量频率范围达 40 GHz
- 市面上最快的微波计数器（采集时间为 25 ms）
- 业界唯一带图形显示的频率计数器
- 高分辨率，单次可达 50 ps（时间），即相当于 12 位/秒（频率）
- 同时显示信号频率和电压参数
- 触发灵敏度为 15 mVrms，从直流到 200 MHz
- 电压分辨率达 1 mV
- USB/GPIB 总线传输速度快，每秒多达 15k 次测量（块模式）
- 零停滞时间频率/周期测量
- 最佳的恒温晶体振荡器（OCXO）时基选项（ $1.5 \times 10^{-8}$ /年）
- MCA3000 系列提供微波载波频率测量以及低至 40 ns 的极短突发脉冲测量
- 0.5 Hz 至 50 MHz 的可编程脉冲输出（FCA3100 系列）
- 10 MHz 基准输出振荡器
- 测量统计模式
- 直方图模式
- 趋势图模式
- 前后输入连接选项

## 文档

查看以下内容，了解在哪些地方可以获取本产品的各类信息。

### 需获取的信息

### 使用的文档

安装和操作（概述）

快速入门用户手册。提供一般的操作信息。

详细的操作和用户界面帮助

用户手册（位于文档浏览器光盘上）。提供有关仪器功能使用的详细说明。

程序员命令

程序员手册（位于文档浏览器光盘上）。包含 GPIB 命令语法。

分析和连接工具

National Instruments SignalView Express 光盘和连接安装说明（位于文档浏览器光盘）。

## 本手册中使用的约定

 
 
整本手册中使用以下图标。

顺序步骤

前面板电源

连接电源

USB



用 > 符号分隔一系列按钮的按击操作。例如，**Meas > Pulse > Width Positive > A**（测量 > 脉冲 > 正频宽 > A）的意思是依次按下 **Meas**（测量）按钮、**Pulse**（脉冲）菜单按钮、**Width Positive**（正频宽）菜单按钮和 **A** 菜单按钮

# 安装

## 打开仪器包装

打开仪器包装，检查是否收到列为“标准附件”的所有物品。请访问 Tektronix 网站 (www.tektronix.com) 了解最新信息、推荐的附件、仪器选件和升级。

### 标准附件

附件	泰克部件编号
FCA3000 和 FCA3100 系列定时器/计数器/分析仪、MCA3000 系列微波计数器/分析仪快速入门用户手册 (英文/简体中文/日文)	071-2787-xx
产品文档光盘	063-4288-xx
NI LabVIEW SignalExpress 光盘	063-4253-xx
电源线	因国家/地区而异
类型 N 针型至 BNC 适配器 (仅适用于 FCA3003、FCA3020、FCA3103 和 FCA3120)	N/A
校准证明	N/A


## 操作注意事项

请验证要使用仪器的区域是否符合以下操作要求：

要求	说明
间隙	顶部和底部：0 毫米 (0 英寸) 左右两侧：51 毫米 (2 英寸) 后部：51 毫米 (2 英寸)
工作电源	100 ~ 240 VAC ±10%，CAT II： 50 ~ 400 Hz ±10%：40 W
温度	工作状态：0 °C 至 +50 °C (32 °F 至 122 °F) 非工作状态：-40 °C 至 +71 °C (-40 °F 至 +160 °F)
湿度	+10 °C 至 +30 °C (50 °F 至 86 °F)：5% 到 95% +30 °C 至 +40 °C (86 °F 至 104 °F)：5% 到 75% +40 °C 至 +50 °C (104 °F 至 122 °F)：5% 到 45%
海拔高度 (最大值)	2000 m (6500 英尺)
最大无损输入电压，输入 A 和输入 B	50 Ω：12 V <sub>rms</sub> ，35 V <sub>峰值</sub> ，占空比低于 0.1% 1 MΩ，1X 衰减器：350 V (DC + AC pk) 至 440 Hz，在 1 MHz 时降至 12 V <sub>rms</sub> 1 MΩ，10X 衰减器：350 V (DC + AC pk) 至 440 Hz，在 1 MHz 时降至 12 V <sub>rms</sub>
最大无损输入电平，输入 C	FCA3003、FCA3103：+34 dBm (12 V <sub>rms</sub> ) FCA3020、FCA3120：+27 dBm (5 V <sub>rms</sub> ) MCA3027、MCA3040：+18 dBm (1.78 V <sub>rms</sub> )

## 接通和断开仪器电源

本仪器使用带接地或近地中性导线的单相电源。(见第1页, *操作注意事项*)通过电源线中的接地导线提供保护性接地对于安全操作十分重要。

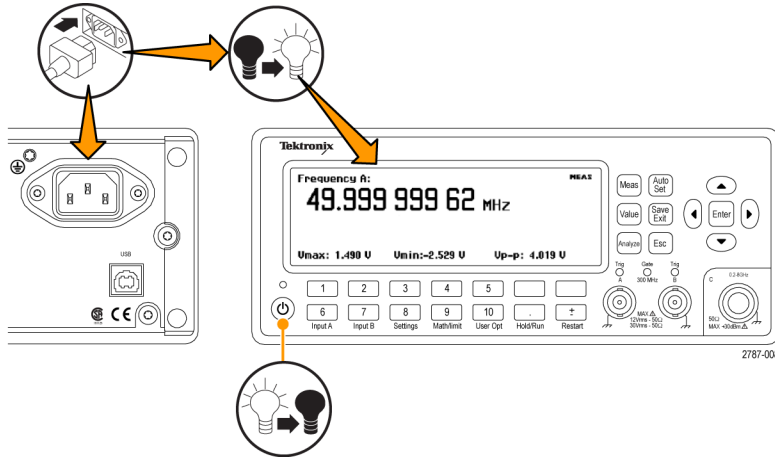


## 功能检查

1. 接通仪器电源
2. 按下 **User Opt** > **Test** (用户选项 > 测试)。
3. 按下 **Test Mode** (测试模式) 菜单按钮并选择 **All** (全部)。
4. 按下 **Start test** (开始测试) 菜单按钮。检查是否通过了所有测试。
5. 按下 **OK** (确定) 菜单按钮返回到上一个测量显示。
6. 将一根 50  $\Omega$  电缆从后面板上的 **10 MHz Output** (10 MHz 输出) 连接器连接到前面板上的 **Input A** (输入 A) 连接器上。
7. 按下 **Input A** (输入 A) 并选择 50  $\Omega$  输入阻抗。
8. 按下 **Meas** > **Freq** > **Freq** > **A** (测量 > 频率 > 频率 > A)。仪器显示的值应该为 10 MHz。




# 认识仪器

## 前面板

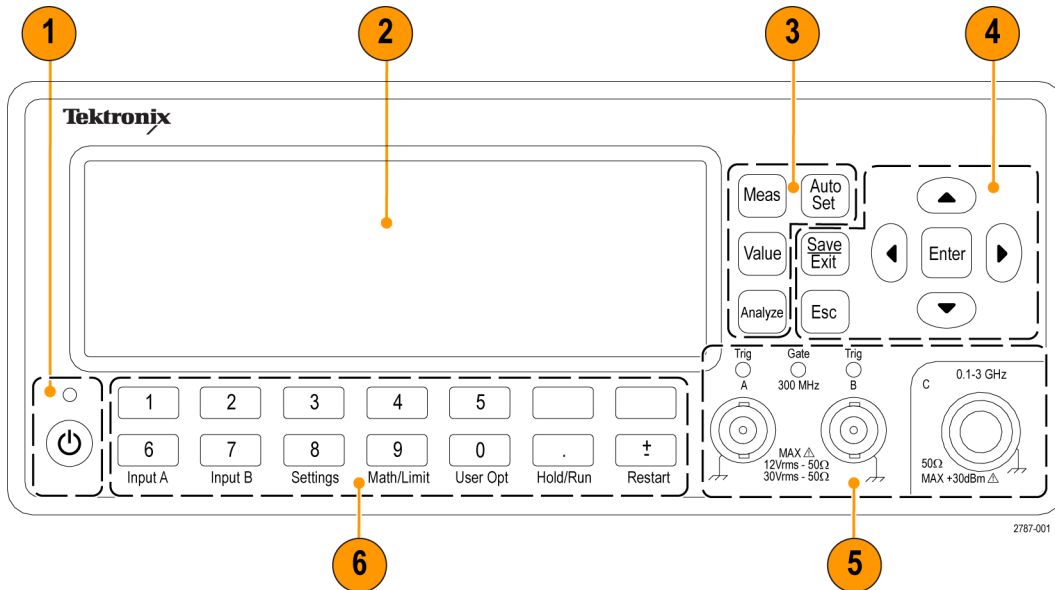


1. 电源按钮 ( 见第5页, *电源按钮*)
2. 主屏幕 ( 见第9页, *主屏幕*)
3. 测量按钮 ( 见第6页, *测量按钮*)
4. 导航按钮 ( 见第6页, *导航按钮*)
5. 输入连接器 ( 见第5页, *输入连接器*)
6. 键盘按钮 ( 见第7页, *小键盘按钮*)

## 后面板

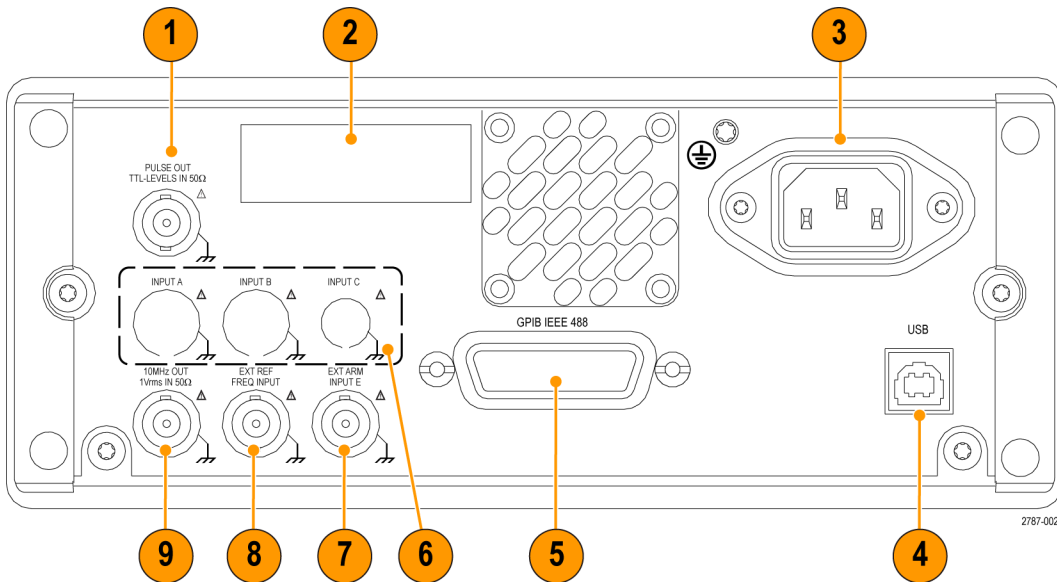

1. 脉冲输出连接器（仅适用于 FCA3100 系列）。（见第5页，防止 ESD）
2. ID 标签，包括型号、序列号、所安装的选件和仪器电源额定值。
3. 线路电源连接器。
4. USB 2.0 12 Mb/s 端口，用于连接 PC。
5. GPIB 端口，用于连接控制器。
6. 可选输入连接器（工厂安装的选件，用于将前面板输入连接器移至后面板）。不适用于 MCA3000 系列仪器。（见第5页，防止 ESD）
7. 外部启动输入连接器（用于外部启动（同步）测量）。另外，也可从 Settings（设置）菜单中选择主输入 A 和 B 进行测量启动。（见第5页，防止 ESD）
8. 外部基准输入连接器（如果在 Settings（设置）菜单中将 Measurement Reference（测量基准）设置为 Auto（自动），则只要存在有效的信号，此输入就会自动选中）。（见第5页，防止 ESD）
9. 10 MHz 输出连接器。提供源自活动测量基准（内部或外部基准）的基准信号。测量基准源在 Settings（设置）菜单中设定。（见第5页，防止 ESD）

## 输入连接器

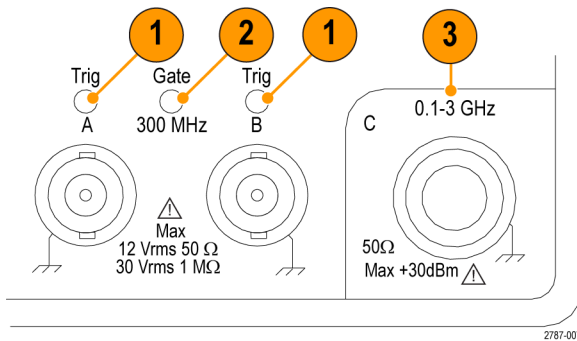

1. 输入 A 和 B 连接器以及输入触发指示器。
2. 选通指示器。当计数器在统计输入周期数时，Gate（选通）指示器就会亮起。
3. 输入 C 预定标器（3 GHz 或 20 GHz，FCA3000 系列和 FCA3100 系列）或下变频器（27 GHz 或 40 GHz，MCA3000 系列），用于测量较高的频率。

**说明：** 带有选件 RP 的仪器在后面板上有输入连接器（仅适用于 FCA3000 系列和 FCA3100 系列仪器）。Gate（选通）和 Trig（触发）A/B LED 指示器仍位于前面板上。

## 防止 ESD



**注意：** 直接静电放电可能会损坏仪器输入端。要了解如何避免这种损坏，请阅读以下信息。

静电放电（ESD）是操作任何电子设备时都需注意的事项。虽然仪器在设计时就带有 ESD 保护，但较大的静电放电直接进入信号输入端仍有可能损坏仪器。为避免损坏仪器，请在对仪器连接任何电缆之前使用以下方法消除您身上以及测试电缆中所带的静电：

- 连接和断开电缆时，佩戴接地的防静电腕带以释放您身上所带的静电。
- 工作台上闲置未连接的电缆会积累大量静电电荷。对准备测试的仪器或设备连接电缆之前，将电缆的中心导线暂时接地，或将一端连接 50 Ω 终端，以便放掉电缆上的静电，然后再将其连接到仪器上。

## 控件

### 电源按钮

项目

说明



**电源按钮**是一种切换式二次电源开关。仪器中有一部分会在线路电源接通后就立即保持开启状态，通过该按钮上方的红色 LED 进行指示。按电源按钮即可接通或断开仪器电源。

## 测量按钮




使用测量按钮可以选择并显示测量值。

项目	说明
	使用 <b>Meas</b> （测量）按钮可在屏幕底部显示仪器测量菜单。按下某一菜单项正下方的菜单按钮可选择该菜单项并根据需要打开子菜单。 典型的测量值包括频率、周期、时间、脉冲、相位、总计（仅适用于 FCA3100 系列）和伏特。可用的菜单项根据仪器型号和配置而异。
	使用 <b>Value</b> （值）按钮可显示当前测得的数值。仪器还会在屏幕下方显示补充测量值。
	使用 <b>Analyze</b> （分析）按钮可通过三种统计分析显示模式之一显示当前测量值。反复按下 Analyze（分析）按钮可循环出现以下统计显示模式： <ul style="list-style-type: none"> <li>■ <b>Numerical display</b>（数字显示）：仪器以数字形式显示统计数据。统计数据读数包括 Mean（N 个取样主测量值的移动平均值）、Max（最大值）、Min（最小值）、P<sup>∧</sup>P（峰-峰偏差）、Adev（艾伦偏差）和 Std（标准差）。（见第10页，<i>数字显示</i>）</li> <li>■ <b>Histogram display</b>（直方图显示）：仪器以直方图形式显示连续的主测量结果。直方图中的容器会根据测得的数据自动缩放。门限（如果有效）和移动平均值 X 显示为垂直虚线。图形中心由 X 轴上的实心三角形表示。直方图底部显示有直方图标度因数、直方图中心测量值和测量完成百分比值。门限设置会影响自动缩放，以同时显示当前测量值以及设定的门限。（见第10页，<i>直方图显示</i>） 使用 <b>Settings &gt; Stat &gt; No. Of Samples</b>（设置 &gt; 统计 &gt; 取样数）菜单可设置水平轴上的容器数量。</li> <li>■ <b>Trend Plot display</b>（趋势图显示）：仪器以趋势图形式显示连续的主测量结果。此模式有助于观察周期性的波动或可能的趋势。趋势图会根据测得的数据自动缩放，重新开始以 0 为起点。门限（如果有效）以水平线显示。（见第11页，<i>趋势图显示</i>）</li> </ul>
	使用 <b>Auto Setx</b> （趋势图显示）按钮可为测量功能和输入信号幅度（对相对正常的信号而言）自动设置触发电平。这样可以快速设置仪器以便显示测量值。 在两秒钟内按两次 Auto Set（自动设置）按钮可将大部分仪器设置（例如测量时间、运算、过滤和启动）复位到默认值。这样是为了防止在更改测量功能或测试设置时发生锁定和误解。








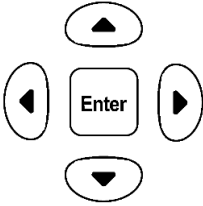

## 导航按钮




使用导航按钮可选择菜单项、增加或减小数字设定值以及清除数值。

     项目	说明
	<p>导航按钮根据各仪器模式提供了多种不同的功能：</p> <p><b>菜单模式：</b>使用向左箭头、向右箭头和 Enter（输入）按钮可显示和选择菜单项（作为使用小键盘菜单选择按钮的替代方式）。</p> <p><b>数字输入模式：</b>使用左箭头按钮可清除设置字段中最右端的数字。使用上箭头和下箭头按钮可增加或减小设置字段中的数值（以 1-2-5 的方式）。</p> <p>使用 Enter（输入）按钮可接受所显示的值或菜单并返回到上一个菜单。</p> <p>当仪器未显示菜单或提示输入时，请使用向上和向下箭头按钮设置 LCD 屏幕对比度。</p>
	使用 <b>Save/Exit</b> （保存/退出）按钮确认当前选择并退回到上一级菜单。
	使用 <b>Esc</b> （退出）按钮直接退回到上一级菜单而不确认当前选择。

### 小键盘按钮

						
Input A	Input B	Settings	Math/Limit	User Opt	Hold/Run	Restart

  使用小键盘按钮可选择菜单项并输入设定值。

项目	说明
数字按钮	使用按钮 1~0、. 和 ± 可输入数字参数值。
菜单选择按钮	使用小键盘顶行按钮（1~5 和两个空白按钮）可选择相应的屏幕菜单项。
菜单访问按钮	使用小键盘底行按钮（6~0）可显示该按钮对应的菜单，如 Input A（输入 A）、Input B（输入 B）、Settings（设置）等。
 	<p>使用 <b>Input A</b>（输入 A）或 <b>Input B</b>（输入 B）按钮可显示所选通道的输入通道配置。</p> <p>Input A（输入 A）和 Input B（输入 B）菜单提供了与通道相关的设置，包括触发斜率、信号耦合（交流或直流）、输入阻抗（50 Ω 或 1 MΩ）、输入衰减（1x 或 10x）、触发模式（手动或自动）、触发电平和滤波器（频率截止）。</p>
	<p>使用 <b>Settings</b>（设置）按钮可显示测量设置配置菜单。</p> <p>Settings（设置）菜单提供了与测量相关的设置，包括测量时间（用于频率测量）、突发脉冲（用于脉冲调制信号）、启动（条件测量开始/停止）、触发释抑（停止触发延迟）、统计（包括取样数在内的统计测量设置）、时基基准（内部或外部）和杂项（例如输入信号超时时间段和自动触发低频设置）。</p> <p>有关这些仪器菜单和设置的完整信息，请参阅《FCA3000 系列和 MCA3000 系列用户手册》。</p>


项目	说明
 Math/Limit	<p>使用 <b>Math/Limit</b>（数学/极限）按钮显示数学和极限测试配置菜单。</p> <p>Math（数学）菜单提供了预定义的公式和用户定义的常数，用于对测量结果进行数学后处理。数学处理的典型用途是转换测量值，以便将作为待测信号一部分的混音器或倍增器考虑在内。</p> <p>通过 Limits（极限）菜单可设置数字极限以及选择仪器报告极限违例的方式。</p>
 User Opt	<p>使用 <b>User Opt</b>（用户选项）按钮可显示用户选项配置菜单。</p> <p>User Options（用户选项）菜单提供了多个仪器设置，包括保存或调出仪器设置（出厂默认设置或者在非易失性存储器中存储的最多二十个用户设置，每个设置都带有唯一的标签）、总线接口选择（USB 或 GPIB）、GPIB 总线配置（模式、地址）、仪器自检、条件脉冲输出信号设置（仅适用于 FCA3100 系列）和仪器配置信息（型号、序列号、固件和配置）。</p> <p>User Options（用户选项）菜单还提供仪器校准功能。此内部校准程序需要密码才能使用。请参阅《FCA3000 和 FCA3100 系列定时器/计数器/分析仪及 MCA3000 系列微波计数器/分析仪技术参考手册》，获取如何进行内部仪器校准的说明。</p>
 Hold/Run	<p>使用 <b>Hold/Run</b>（保持/运行）按钮可控制测量值采集。按下此按钮可在运行（不断采集测量值）和保持（测量暂停）模式之间进行切换。</p> <p>仪器处于测量保持模式时，屏幕右上角的测量指示器将从 MEAS（测量）变为 HOLD（保持）。再次按下 Hold/Run（保持/运行）按钮可继续正常（连续）测量模式。</p> <p>处于保持模式时，可以按下 Restart（重新启动）按钮进行单次测量。仪器进行单次测量时，屏幕右上角的测量指示器将从 HOLD（保持）变为 SING（单次）。</p>
 Restart	<p>使用 <b>Restart</b>（重新启动）按钮可将测量值归零，然后重新进行测量。这在输入信号发生更改后需要启动新测量时（尤其是使用较长的测量时间时）十分有用。</p> <p>要进行单次测量，请按下 Hold/Run（保持/运行）以将仪器置于 Hold（保持）模式（测量指示器从 MEAS（测量）变为 HOLD（保持）），然后按下 Restart（重新启动）按钮。测量指示器从 HOLD（保持）变为 SING（单次），仪器进行测量，然后指示器恢复为 HOLD（保持）。</p> <p>重启不会影响任何仪器设置。</p>

## 主屏幕

仪器使用单色 LCD 显示信号源、仪器测量结果（数字和图形）和菜单项。所显示的项目内容取决于显示模式。

### 测量值模式


按下 Value（值）按钮启用此模式并显示当前测量项的高分辨率数字读数。

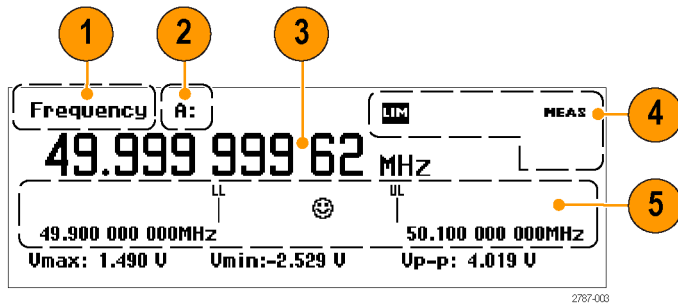

1. 当前测量项。
2. 测量信号源。
3. 主测量读数。屏幕底部的读数显示源信号的电气信息。读数或显示会随测量项或分析模式而变化。
4. 测量状态。显示数学或门限测试模式（MATH（数学）或 LIM（门限））、测量状态（MEAS（测量）、HOLD（保持）或 SING（单次）），以及当前是否从 GPIB 总线远程控制（REM）仪器。在所有显示模式下都会显示测量状态。
5. 门限告警读数（如果有效）。下限（LL）和上限（UL）设置显示为带有关联极限值的垂直条。表情符号图标显示相关的测量值和门限通过/不通过状态（测量值在门限范围内时显示笑脸，测量值在门限范围之外时显示皱眉表情）。当测量值超出极限时，屏幕顶部的 LIM（极限）状态文本会闪烁，即使测量值恢复到极限范围内也会继续闪烁。按下 **Restart**（重新启动）按钮可复位 LIM（门限）指示器。

## 菜单模式

按下菜单按钮（Meas（测量）、Input A（输入 A）、Input B（输入 B）、Settings（设置）、Math/Limit（数学/门限）或 User Opt（用户选项）），可将屏幕下方区域替换为该按钮的菜单项。下图显示了 Meas（测量）按钮的菜单项。

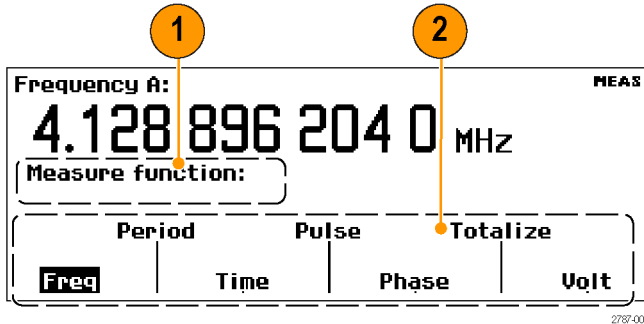


1. 路径区域显示当前菜单选项的菜单路径。
2. 菜单区域显示可用的菜单选项。按下某菜单项正下方的小键盘按钮可选择该项和/或打开下一级别的菜单。当前选项以反白文本显示。另外，还可以使用导航按钮突出显示和选择菜单项。

## 分析模式

分析模式（可通过反复按下 Analyze（分析）按钮进行访问）用于将基本的统计分析应用于测量项，以便通过数字、直方图或趋势图方式显示统计分析结果。


**数字显示：** 仪器进行连续测量并以数字统计读数显示测量结果。

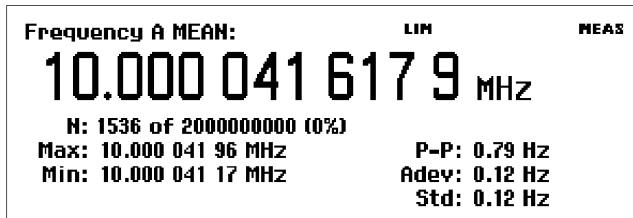

- MEAN: 主测量值显示 N 个取样的移动平均值。
- N: 测量取样数（在 Settings > Stat（设置 > 统计）菜单中设置）。
- Max、Min: 最大测量值和最小测量值。
- P~P（峰-峰）：峰-峰偏差。
- Adev（艾伦偏差）：艾伦偏差。
- Std（标准）：标准差。


**直方图显示：** 仪器以直方图形式显示连续的测量结果。水平轴上的容器数量在 Settings > Stat（设置 > 统计）菜单中设置。



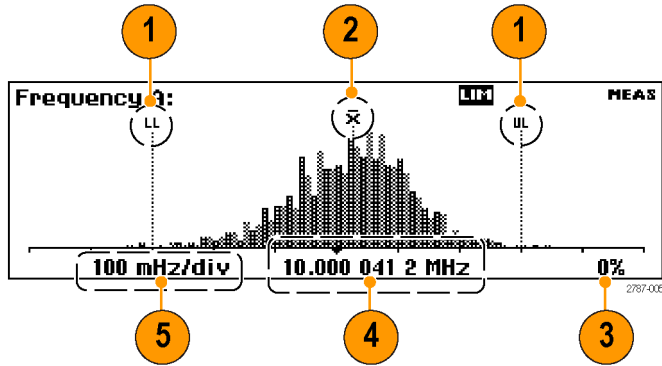

1. 上限和下限告警电平（如果有效）。当极限测试处于活动状态时，仪器会自动缩放图形以显示直方图和极限。仪器仅使用极限范围内的数据进行自动缩放；对于可见图形区域之外的测量值，显示屏左边沿或右边沿将会显示一个箭头。
2. 移动平均测量值 ( $\bar{x}$ )。
3. 测量完成的百分比。
4. 图形中心（以黑色三角形标记）和相应频率。
5. 每格的图形水平标度。极限告警（如果有效）将标度设置为显示当前测量值和极限设置。仪器根据测得的数据持续自动缩放直方图容器。

**趋势图显示：** 仪器进行连续测量并按时间的发展绘制测量值的点线图。此模式有助于观察波动或测量值的偏差趋势。设定的取样数完成后，趋势图将会停止（如果激活 Hold（保持））或者重新启动（如果激活 Run（运行））。趋势图会根据测得的数据连续自动缩放，重新启动时以 0 为起点。极限告警（如果有效）以水平线显示。

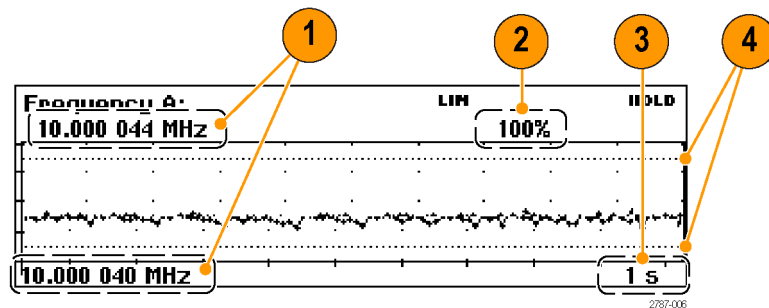


1. 趋势图显示的上段和下段频率范围。趋势图会根据测得的数据持续自动缩放以显示测量趋势值。
2. 测量完成的百分比。
3. 每格的水平单位。
4. 极限告警电平（如果有效）。当极限测试处于活动状态时，仪器会设置图形标度以显示测量趋势图和极限值（水平虚线）。

## 应用示例

本部分示例的假设条件如下（除非另有说明）：1 MHz 的信号；使用 50  $\Omega$  电缆与仪器相连的 5 Vpp 方波信号源；输入信号电平和频率在可接受的范围内。

### 恢复默认设置


1. 按下 **User Opt > Save/Recall > Setup > Recall Setup > Default**（用户选项 > 保存/调出 > 设置 > 调出设置 > 默认设置）可调出（加载）仪器默认设置。仪器默认显示 Frequency（频率）测量项。

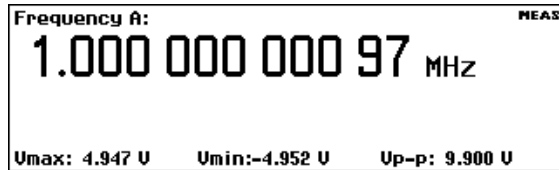


### 基本测量

前提条件：将仪器复位到默认设置。（见第12页，[恢复默认设置](#)）

1. 按下 **Meas**（测量）以打开 Measurement（测量）菜单。
2. 使用菜单项下方菜单软键选择测量项。

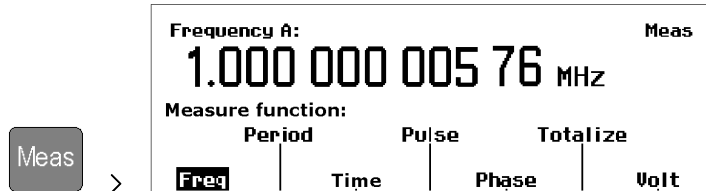

例如，选择 **Period > Single > A**（周期 > 单次 > A）可显示输入 A 的周期测量。

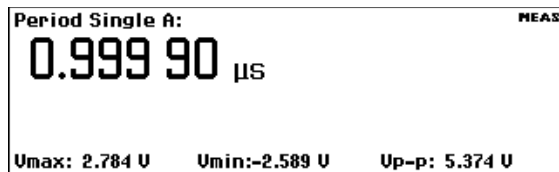


## 数学测量


内置的数学函数可用于应用后处理运算，例如对测量值进行缩放和偏置。此功能的其中一个用途便是显示理想值的偏差。这称为偏置。公式中的 X 值代表仪器测量值。

前提条件：将仪器复位到默认设置。（见第12页，[恢复默认设置](#)）


1. 按下 **Math/Limit**（数学/门限）以打开 **Math and Limits**（数学和门限）菜单。

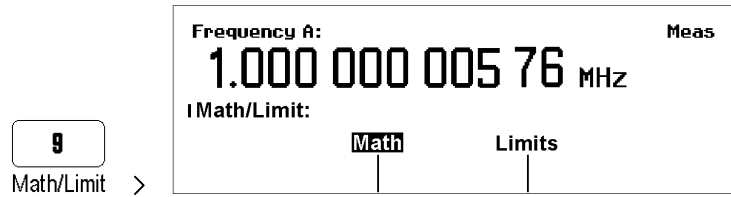


2. 选择 **Math > Math Off > (K\*X+L)/M**（数学 > 关闭数学运算 > (K\*X+L)/M）。

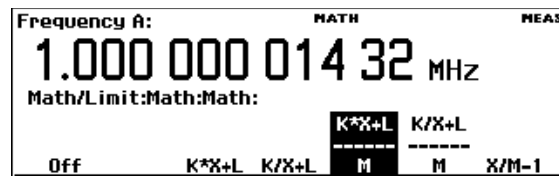

3. 选择 **L** 并输入 **-1 EE6**。

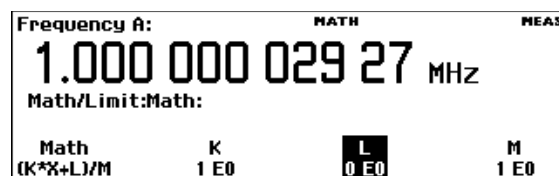


4. 反复按下 **Save/Exit**（保存/退出）以退出各级菜单并返回到测量读数。仪器会显示 1 MHz 的偏差频率（在本例中为 29.91 毫赫）。

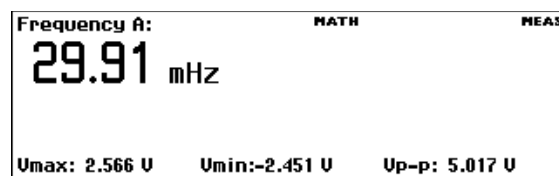

## 极限测试

此示例测试频率门限，但大多数测量都可设置测试门限。


1. 将仪器复位到默认设置。（见第12页，[恢复默认设置](#)）
2. 按下 **Math/Limit**（数学/门限）并选择 **Limits**（门限）。

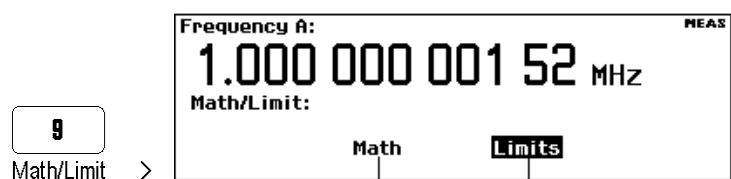


- 按下 **Limit Behavior Off**（门限行为关闭）并选择 **Alarm\_Stop**（告警\_停止）。仪器会返回到上一个菜单并将 **Limit Behavior**（门限行为）菜单标签更改为 **Alarm\_Stop**（告警\_停止）。



- 验证 **Limit Mode**（门限模式）是否设置为 **Range**（范围）。

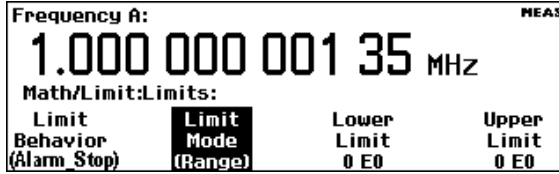


- 选择 **Lower Limit**（下限）并输入测量下限值。按下 **Enter**（输入）或 **Save/Exit**（保存/退出）以接受该值。  
 重复执行此步骤以设置 **Upper Limit**（上限）值。

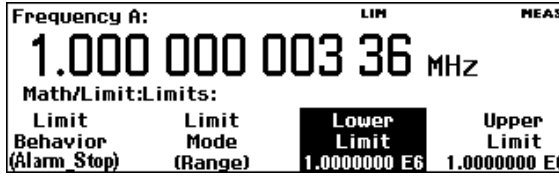

Math/Limit:Limits:  
 Lower Limit: 1.000000001 EE6

- 反复按下 **Save/Exit**（保存/退出）以退出菜单系统并返回到测量显示。然后按下 **Restart**（重新启动）。

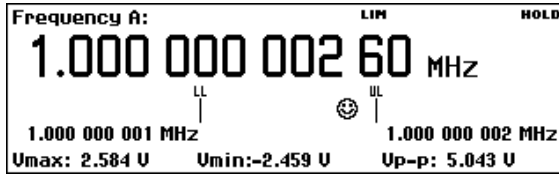

范围模式门限测试读数使用垂直线表示下限和上限值，使用笑脸表情符号表示测量值在门限范围内。


在所显示的门限之外的测量值将以皱眉表情符号和闪烁的 **LIM**（门限）状态指示器表示。



超出门限测试标度的测量值将以屏幕左边沿或右边沿的箭头表示。仪器仅使用门限范围内的数据进行自动缩放。



- 您也可以将门限设置显示为其他读数的一部分。例如，反复按下 **Analyze**（分析）按钮，直到仪器显示直方图读数为止。


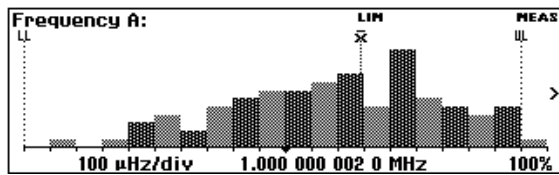


- 要停止（禁用）门限测试，请按下 **Math/Limit > Limit Behavior > Off**（数学/门限 > 门限行为 > 关闭）。

## 双通道测量

前提条件：将仪器复位到默认设置。（见第12页，[恢复默认设置](#)）

- 按下 **Input A**（输入 A）和 **Input B**（输入 B）按钮并验证这些设置是否适合于所需的测量。此示例中的输入设置相同。
- 将信号连接到输入 A 和 B。
- 按下 **Meas**（测量）并选择 **Phase > B Rel A**（相位 > B 相对于 A）。仪器会显示 B 输入相对于 A 输入的相位差。
- 按下 **Meas**（测量）并选择 **Time > Time Interval > A to B**（时间 > 时间间隔 > A 到 B）。仪器会显示输入 A 的上升边沿到输入 B 的上升边沿之间的时间间隔。

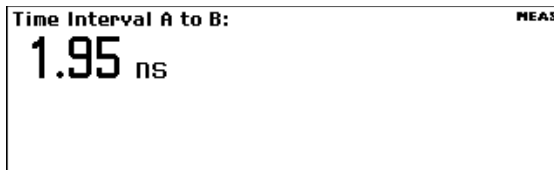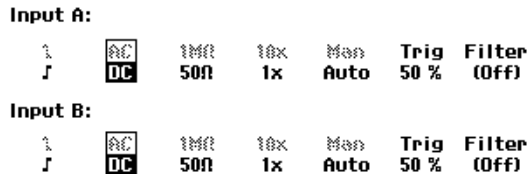

## 输入 C 测量

包含输入 C 高频预定标器（FCA3000 系列、FCA3100 系列）或下变频器（MCA3000 系列）的仪器提供了一部分用于 C 输入的测量。这些测量为频率、频率比（C 比 A 和 C 比 B）、频率突发脉冲和周期（平均值）。输入 C 添加在仪器的相关菜单中。

 
请按照正常的步骤设置仪器以便对输入 C 进行测量。有关输入 C 测量的详细信息，请参阅《FCA3000 系列、FCA3100 系列和 MCA3000 系列用户手册》。

## 保存仪器设置

仪器提供了 20 个非易失性存储器位置，用于存储仪器设置信息。所有的仪器参数都将存储起来，包括测量设置、触发电平、数学常数等。您可以使用唯一标识符为存储的每个设置加上标签（最多七个字符）。

**说明：** 恢复默认仪器设置不会清除内存中存储的设置。


1. 将仪器设置为要保存的配置。
2. 按下 **User Opt > Save/Recall > Setup > Save Current Setup**（用户选项 > 保存/调出 > 设置 > 保存当前设置）。
3. 选择 **Next**（下一步），直到仪器显示可用的位置（以黑色字体编号表示）。空白或不可用的位置以灰色文本表示。
4. 按菜单键选择位置编号。



**说明：** 设置位置 1 到 10 默认受到保护，以防止其内容被意外覆盖。有关设置位置保护的信息，请参阅用户手册。



5. 使用菜单软键输入仪器设置文件的标签（最多七个字符）。默认标签来自于当前测量。
6. 使用导航按钮在字符间进行退格删除操作或者将插入光标移至新位置。
7. 按下 **Enter**（输入）或 **Save/Exit**（保存/退出）以接受标签文本并保存仪器设置。

Setup 11 label: **freqA**  
1abc 2def 3ghij 4klmn 5opqr stuv wxyz

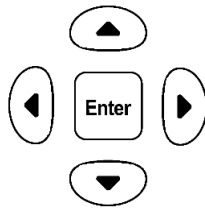

## 调出设置

1. 按下 **User Opt > Save/Recall > Setup > Recall Setup** (用户选项 > 保存/调出 > 设置 > 调出设置)。
2. 按 **Next** (下一步) 菜单按钮显示从中调出仪器设置的位置。空白位置以灰色文本表示。
3. 按下设置位置的菜单按钮。仪器将加载设置并显示与该设置相关的测量。

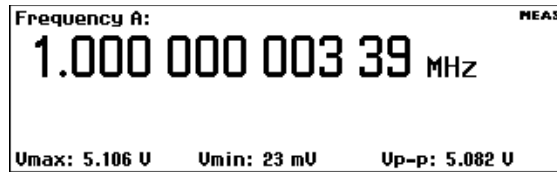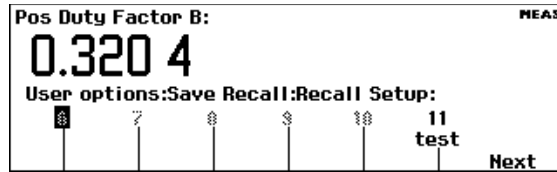

## 连接能力

利用 FCA3000、FCA3100 和 MCA3000 系列工作台仪器快速的 USB 和 GPIB 总线传输速度，您可以使用专门的 National Instruments LabVIEW SignalExpress™ Tektronix Edition 软件轻松地对测量结果进行捕获、保存和分析。每台仪器都随附一份免费的泰克版 SignalExpress，用于基本的仪器控制、数据记录和分析。可选的完整版提供了 200 多项内置功能，包括附加信号处理、高级分析、扫描、门限测试和用户定义步骤等功能。

SignalExpress 将整个系列的 Tektronix 工作台仪器连接起来，使您可以通过一个直观的软件界面访问每种仪器中功能丰富的工具。通过单个界面可将需要多种仪器的复杂测量自动化、对来自多种仪器的数据进行时间关联、针对过长的时间对数据进行日志记录以及轻松地捕获和分析测量结果，所有这一切都可通过您的 PC 完成。

可选的 TimeView™ 调制域分析 PC 软件应用程序 (TVA3000) 能实现仪器远程控制，并通过各种图表形式分析和显示测量结果。您可以分析几乎任何类型的时间或频率动态变化，包括调制、抖动、漂移、扫描线性、频率捷变通信、无线局域网、蓝牙跳频、VCO 频率响应等。例如，您可以将测量结果显示为原始数据、统计直方图、波形图（就像在使用示波器）或者 FFT 频谱图。通过使用 TimeView 您还可以分析调制参数，例如调制深度或频率调制指数。您可以从 Tektronix 网站 ([www.tektronix.com](http://www.tektronix.com)) 下载 30 天试用版的 TimeView。